Environmetnal Team Services for Contract No. SS H504 Design and Construction of Chai Wan Government Complex and Vehicle Depot

47th Monthly EM&A Report (September 2025)

Cetrified by	/:	
--------------	-----------	--

Fredrick Leong

Environmental Team Leader (ETL)

Aurecon Hong Kong Limited

Date:

14 October 2025

Verified by:

Claudine Lee

Independent Envirnonmental Checker (IEC)

Meinhardt Infrastructure and Environment Limited

Date:

14 October 2025

Contract No. SS H504
Design and
Construction of Chai
Wan Government
Complex and Vehicle
Depot

47th Monthly EM&A Report **Yau Lee Construction Co, Ltd**2025-10-13



Document control record

Document prepared by:

Aurecon Hong Kong Limited

Unit 1608, 16/F, Tower B, Manulife Financial Centre,

223 – 231 Wai Yip Street, Kwun Tong, Kowloon

Hong Kong S. A. R.

T +852 3664 6888

F +852 3664 6999

E hongkong@aurecongroup.com

W aurecongroup.com

A person using Aurecon documents or data accepts the risk of:

- Using the documents or data in electronic form without requesting and checking them for accuracy against the original hard copy version.
- b) Using the documents or data for any purpose not agreed to in writing by Aurecon.

Document control aurecol						áurecon
Repo	Report title 47th Monthly EM&A Report					
Docu	ment ID	MMR	Project number P520574			
File p	ath	520574-0000-PLN-NM-00045	5 [0]			
Client	t	Yau Lee Construction Co, Ltd				
Client contact			Client reference			
Rev	Date	Revision details/status	Author	Reviewer	Verifier (if required)	Approver
0	13 October 2025	Submitted to IEC	Various	K.Chau		FL
Curre	Current revision 0					

Approval			
Reviewer's signature		Approver's signature	Two to the state of the state o
Name	Keith Chau	Name	Fredrick Leong
Title	Associate, Environmental	Title	Environmental Team Leader



Contents

Ex	ecutive Summaryecutive Summary	1
	Introduction	
	Project Information	
	Environmental Monitoring Requirements	
4	Implementation Status on Environmental Mitigation Measures	. 11
5	Monitoring Results	. 12
6	Environmental Site Inspection	. 13
7	Environmental Non-conformance	. 13
	Future Key Issues	
9	Review of EM&A Data and EIA Predictions	. 16
10	Conclusion	. 20

Appendix

Appendix 1	Construction Programme
Appendix 2	Project Organization Chart and Contact Details
Appendix 3	Monitoring Programme for Reporting Period
Appendix 4	Calibration Certificates
Appendix 5	Event and Action Plan
Appendix 6	Implementation Status of Mitigation Measures
Appendix 7	Monitoring Results with Graphical Presentations
Appendix 8	Waste Flow Table
Appendix 9	Joint site inspection record for Reporting Period
Appendix 10	Monitoring Schedule for the Next Month
Appendix 11	Notification of Environmental Quality Limits Exceedance
Appendix 12	Cumulative Complaint / Enquiry Log, Summaries of Complaints and Enquiries

All rights reserved | The information/data furnished in our document is confidential and competitive information proprietary to Aurecon or its sub-contractors, the release of which would harm the competitive position of Aurecon or its sub-contractors/consultants. This information/data shall not be reproduced, stored in a retrieval system, transmitted in any form or by any means, used or disclosed in whole or in part, for any purpose other than to evaluate and adjudicate this document. If Aurecon is shortlisted or a contract is awarded to Aurecon as a result of this solicitation, or in connection with the submission of such information/data, the right (and the extent thereof) to reproduce, store, transmit, use or disclose this information/data must, by agreement, be included in such contract.



Executive Summary

Aurecon Hong Kong Limited (Aurecon) was commissioned by the Yau Lee Construction Co, Ltd (Yau Lee) to undertake the role of Environmental Team (ET) for carrying out the environmental monitoring and audit (EM&A) works for the "Contract No. SS H504 Design and Construction of Chai Wan Government Complex and Vehicle Depot (The Project).

An Environmental Permit (EP) No. EP-505/2015 was issued by the Environmental Protection Department (EPD) on 17 December 2015 for the construction of this project based on the Environmental Impact Assessment (EIA) Report (Register No: AEIAR-191/2015) approved by the EPD. The latest EP No. EP-505/2015/A was subsequently issued by the EPD on 8 November 2019 based on the documents (including an Environmental Review Report (ERR)) for the application of Variation of Environmental Permit.

The construction phase and EM&A programme of the Project commenced on 25 November 2021.

This 47th Monthly EM&A Report presents the EM&A works conducted from 01 September 2025 to 30 September 2025 in accordance with the EM&A Manual.

Summary of Construction Works undertaken during Report Period

The major construction works undertaken during the reporting period include:

- Superstructure works has been completed in mid-Mar 2025
- All MiC modules and precast elements has been finished installation
- Architectural finishing works, Landscape Works and BS installation works

Environmental Monitoring and Audit Progress

A summary of the monitoring activities in this reporting period is listed below:

-	Construction Noise Monitoring during normal weekdays at each monitoring station	5 times
-	Joint Environmental Site Inspection	4 times

Noise

5 sets of 30-minute construction noise measurement were carried out at each monitoring stations during normal weekdays of the reporting period. No exceedance of Action and Limit Levels of construction noise was recorded during the reporting period.

Environmental Site Inspection

Joint environmental site inspections were carried out on 04, 10, 18, and 25 September 2025. The joint environmental site inspection was carried out by the representatives of the Engineer's Representative (ER), the Contractor, IEC and the ET on 10 September 2025. The Contractor has generally implemented the mitigation measures as recommended.

Environmental Exceedance/Non-conformance/Compliant/Summons and Prosecution

No exceedance of the Action and Limit Levels of construction noise was recorded at designated monitoring stations during the reporting period.

No non-compliance event was recorded during the reporting period.

No environmental complaint and no summons/prosecutions were received in this reporting period.

EPD general site inspection was not conducted in the reporting month. No special findings were identified.

Future Key Issues

Works to be undertaken in the next month include:

Preparation works for Gov. inspection works

Potential environmental impacts arising from the above construction activities are mainly associated with dust, construction noise, site runoff and waste management.

1 Introduction

1.1.1 Aurecon Hong Kong Limited (Aurecon) was commissioned by the Yau Lee Construction Co, Ltd (Yau Lee) to undertake the role of Environmental Team (ET) for carrying out the environmental monitoring and audit (EM&A) works for the "Contract No. SS H504 Design and Construction of Chai Wan Government Complex and Vehicle Depot (The Project).

1.2 Purpose of this Report

1.2.1 This is the forty-seventh EM&A report which summarises the impact monitoring results and audit findings for the EM&A programme during the reporting period from 01 September 2025 to 30 September 2025.

1.3 Structure of the Report

1.3.1 The structure of the report is as follows:

Section 1 - Introduction

- details the background, purpose and structure of the report.

Section 2 - Project Information

 summarises background and scope of the Project, site description, project organization and contact details, construction programme, the construction works undertaken and the status of Environmental Permit(s)/License(s) during the reporting period.

Section 3 - Environmental Monitoring Requirement

 summarises the monitoring parameters, monitoring programmes, monitoring methodologies, monitoring frequency, monitoring locations, Action and Limit Levels, Event/Action Plans.

Section 4 - Implementation Status on Environmental Mitigation Measures

 summarises the implementation of environmental protection measures during the reporting period.

Section 5 - Monitoring Results

- summarises the monitoring results obtained in the reporting period.

Section 6 - Environmental Site Auditing

 summarises the audit findings of the weekly site inspections undertaken within the reporting period.

Section 7 - Environmental Non-conformance

 summarises any monitoring exceedance, environmental complaints and environmental summons within the reporting period.

Section 8 - Future Key Issues

- summarises the impact forecast and monitoring schedule for the next reporting month.

Section 9 - Review of EM&A Data and EIA Predictions

 compares and contrasts the EM&A data in the month with the EIA predictions and annotates with explanation for any discrepancies.

Section 10 - Conclusions

2 Project Information

2.1 Background

- 2.1.1 On 5 October 2015, the Environment Impact Assessment (EIA) for the proposed "Chai Wan Government Complex and Vehicle Depot" (AEIAR-191/2015, hereafter referred to as "the Project") was approved and an Environmental Permit (EP) (EP-505/2015) for the construction of the Project was issued. The latest EP No. EP-505/2015/A was subsequently issued by the EPD on 8 November 2019 based on the documents (including an Environmental Review Report (ERR)) for the application of Variation of Environmental Permit.
- 2.1.2 The construction phase and EM&A programme of the Project commenced on 25 November 2021.

2.2 Site Description

2.2.1 The scope of works of the Project, which is a Designated Project under the EIA Ordinance (EIAO), will construct joint user building comprising the government office, store, laboratory, transport pool and vehicle depot facilities in Chai Wan District. The Site is bounded by NWFB Depot to the north, Sheung On Street to the east, Sheung Mau Street to the south and Sheung Tat Street to the west. A layout plan of the Project is provided in **Figure 1-1**.

Figure 1-1 A layout plan of the Project

2.3 Construction Activities

2.3.1 A summary of the major construction activities undertaken in this reporting period is shown in **Table 2.1** and the construction programme is illustrated in **Appendix 1**.

Table 2-1 Major Construction Activities Undertaken in the Reporting Period

Construction Activities Undertaken Superstructure works has been completed in mid-Mar 2025 All MiC modules and precast elements has been finished installation

Architectural finishing works, Landscape Works and BS installation works

2.4 Project Organisation

2.4.1 The Project organization chart and contact details are shown in **Appendix 2**.

2.5 Status of Environmental Approval Document

2.5.1 A summary of the relevant valid permits, licences, and/or notifications on environmental protection for this Project since the granting of the EP is presented in **Table 2.2**.

Table 2-2 Summary of the relevant valid permits, license, and/or notification on environmental protection

Permit / Licenses / Notification	Reference	Validity Period	Remark
Environmental Permit (EP)	EP-505/2015/A	Throughout the Contract	Permit granted on 8 November 2019
Notification of Construction Works as required under Air Pollution Control (Construction Dust) Regulation	469716	Throughout the Contract	Approved on 21 July 2021
Registration of Waste Producer under Waste Disposal Ordinance	7041313	Throughout the Contract	Approved on 13 August 2021
Registration as Chemical Waste Producer	5213-163-Y2782-01	Throughout the Contract	Approved on 24 August 2021
Effluent Discharge License under Water Pollution Control Ordinance	WT00038924-2021	30 September 2026	Approved on 9 December 2021

3 Environmental Monitoring Requirements

3.1 Noise Monitoring Locations

3.1.1 The noise monitoring locations in approved EM&A Manual are summarised in **Table 3-1** and shown in **Figure 3-1**.

Table 3-1 Noise Monitoring Station in Approved EM&A Manual

Noise Monitoring ID	Proposed Noise Monitoring Location	Remark
NM1	Ground Floor at Heng Fa Chuen Block 50	-
NM2b	Pedestrian road at Shing Tai Road	*
NM3	Rooftop of THEi Campus	-

Remark: * -

Hong Kong Institute of Vocational Education (Chai Wan) - Academic Block (NM2) is the noise monitoring stations for the construction phase EM&A programme as identified in the approved EM&A Manual for the Project. The access to NM2 and Knight Court (as a VTC Senior Quarters and NSR3 in approved EIA) were denied. A search for alternative noise monitoring locations along Shing Tai Road and Sheung Mau Street was carried out during the site visit on 4 October 2021

Lamp Post no. 47447 at Sheung Mau Street (NM2a), which is located between project site and original noise monitoring location, Hong Kong Institute of Vocational Education (Chai Wan) - Academic Block (NM2), is found suitable and available to be an alternative noise monitoring location for NM2. Also, NM2a, which has a direct line of sight towards project site (where construction works will be carried out and likely to have noise impacts), is located closer to project site than NM2 and thus considered as a representative noise monitoring location. Monitoring position at NM2a is proposed at 2m above ground due to security concerns and minimize the road traffic noise contribution. Noise measurement at NM2a will be considered as free-field and a correction of +3dB(A) would be made to the noise monitoring results. The alternative location of NM2a, were therefore proposed and agreed by the Independent Environmental Checker (IEC).

Due to the adjustment of the location of NM2 to NM2a, the measured noise levels at NM2a would represent the noise levels at NM2.

To respond to the comment raised by EPD on monitoring location of NM2a by email dated 23 May 2022 and site meeting on 6 June 2022, the monitoring location of NM2a was adjusted to the pedestrian road at Shing Tai Road (NM2b) which is located between project site and original noise monitoring location, Hong Kong Institute of Vocational Education (Chai Wan) - Academic Block (NM2). Compared with NM2a, NM2b is far away from the traffic light and therefore should be able to minimise the traffic noise issue. This arrangement was started from 28 June 2022 and has been agreed by the Independent Environmental Checker (IEC). Noise measurement at NM2b will be considered as free-field and a correction of +3dB(A) would be made to the noise monitoring results.

Due to the adjustment of the location of NM2a to NM2b, the measured noise level at NM2b would represent the noise levels at NM2.



Location of Noise Monitoring Stations (NM1, NM2b and NM3)

Monitoring Parameters, Frequency and Duration 3.2

- 3.2.1 Weekly construction noise monitoring was conducted in accordance with the requirements stipulated in the EM&A Manual. The monitoring programme for this reporting period is shown in Appendix 3.
- 3.2.2 Table 3-2 summarizes the monitoring parameters, frequency and duration of the impact noise monitoring.

Table 3-2 **Noise Monitoring Parameters, Period and Frequency**

Time Period	Parameters
Daytime on normal weekdays (0700-1900 hrs)	$L_{eq(30 \text{ mins})}$, $L_{10(5 \text{ mins})}$ and $L_{90(5 \text{ mins})}$
Evening time on all days (1900-2300 hrs) and Holidays (including Sundays) during daytime and evening (0700-2300 hrs)	$L_{eq(5 \text{ mins})}\text{, }L_{10(5 \text{ mins})}$ and $L_{90(5 \text{ mins})}$
All days during the night-time (2300-0700 hrs	L _{eq(5 mins)} L _{10(5 mins)} and L _{90(5 mins)}
of the next day)	

3.3 Monitoring Equipment

- 3.3.1 Noise measurements were conducted in accordance with the calibration and measurement procedures as stated in Annex General Calibration and Measurement Procedures of Technical Memorandum on Noise from Construction Work other than Percussive Piling (GW-TM) issued under the Noise Control Ordinance (NCO) (Cap.400).
- 3.3.2 The sound level meter and calibrator used for the noise measurement, as listed in **Table 3-3**, complies with IEC 651: 1979 and 804:1985 (Type 1) specification. The calibration certificates of the sound level meter and calibrator are given in **Appendix 4**.

Table 3-3 Noise Monitoring Equipment

Monitoring Station	Monitoring Equipment (Sound Level Meter and Calibrator)
NM1	
NM2b	Sound Level Meter: Rion NL 52(s/n: 00331805) Calibrator: Larson Davis Cal 200(s/n: 10227)
NM3	Calibrator. Larson Davis Car 200(s/11. 10227)

- 3.3.3 Immediately prior to and following the noise measurements, the accuracy of the measurement equipment was checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Measurements were accepted as the calibration level from before and after the noise measurement agree to within 1.0 d(B).
- 3.3.4 A portable wind speed meter shall be used for measuring wind speeds in m/s.

3.4 Event / Action Plan

Table 3-4 Action and Limit Levels for Construction Noise Monitoring

Monitoring Station	Action Level	Limit	Level
		Noise Criteria, Leq _(30mins) , dB(A)	Remark
NM1		75	
		70	-
NM2b	When one documented complaint is received	65 (during examination)	Applicable during 0700 – 1900 hours,
		70	Monday to Saturday
NM3		65 (during examination)	

3.4.1 Should non-compliance of the noise criteria occur, the Event and Action Plan as presented in **Appendix 5** should be followed.

3.5 Mitigation Measures

3.5.1 The mitigation measures in accordance with the EP, EIA and EM&A Manual and their implementation status are presented in **Appendix 6**.

4 Implementation Status on Environmental Mitigation Measures

- 4.1.1 The Contractor has generally implemented environmental mitigation measures and requirements as stated in the EIA Report, the EP and EM&A Manual and the contract documents. The implementation status during the reporting period is summarized in **Appendix 6**.
- 4.1.2 The implemented environmental mitigation measures are listed as follow:
 - I. The timing and sequence of construction activities were carefully arranged.
 - II. QPME were used to reduce the excessive noise impact.
 - III. Good site practices were implemented to reduce noise impact of the site activities. The practices are listed as below:
 - Use only well-maintained and regularly-serviced plant during the works;
 - Turn off or throttle down the plant in intermittent use to a minimum;
 - Orient the plant known to emit noise strongly in one direction to face away from the NSRs:
 - Use silencers, mufflers and enclosures for plant where possible and maintain properly throughout the works;
 - Site fixed plant as far away from NSRs as possible; and
 - Use stockpiles of excavated materials and other structures such as site buildings effectively to screen noise from the works.
 - IV. Movable noise barrier/acoustic sheet barriers as noise shield were adopted as far as practicable following the Construction Noise Management Plan (CNMP).

5 Monitoring Results

5.1 Noise

5.1.1 A total of 5 sets of 30-minute construction noise measurements were carried out at the monitoring stations (NM1, NM2b and NM3) during normal weekdays of the reporting period. The monitoring results together with graphical presentations are presented in **Appendix**7. The local impacts observed near the monitoring stations were summarized below:

NM1: Railway noise, traffic noise and Yau Lee Site.

NM2b: Road traffic noise and Yau Lee Site.
NM3: Cargo Handling Area and Yau Lee Site.

- 5.1.2 No exceedance of Action and Limit Levels of construction noise was recorded during the reporting period. Therefore, there was no record of Notification of Environmental Quality Limits Exceedance in the **Appendix 11**.
- 5.1.3 Baseline corrections were made when the measured noise level is higher than both the noise limit level and the baseline level, and it is made by deducting the measured noise levels with their corresponding baseline noise level. The corrected noise level (ie. Construction Noise Level) would solely represent the noise levels of Construction works.
- 5.1.4 The methodology is shown as below:
 - When Measured noise level (Leq 30mins) > Baseline noise level (Leq30),
 Construction noise level is calculated
 - Construction noise level = Measured noise level (Leq 30 mins) Baseline noise level
 - If Measured noise level (Leq 30mins) < Baseline noise level, Corrected noise level = Measured noise level

5.2 Waste Management

Wastes generated from this Project include inert construction and demolition (C&D) materials and non-inert C&D materials. Non-inert C&D materials were made up of general refuse, steels and paper/cardboard packaging materials. Steel materials generated from the Project were also grouped into non-inert C&D materials as the materials were not disposed of with other inert C&D materials. With reference to relevant handling records and trip tickets of this Project, the quantities of different types of waste generated in the reporting period are summarised in **Appendix 8**. The non-inert C&D materials and general refuse generated from the Project were disposed of at the NENT Landfill. A total of 265.81 tonnes of general refuse was generated during the reporting period. The inert C&D materials generated from the Project were disposed of at the Chai Wan Public Fill Barging Point (CW-PFBP) or Fill Bank at Tseung Kwan O Area 137(TKO137FB). A total of 15.72 tonnes of inert waste was generated during the reporting period.

6 Environmental Site Inspection

- 6.1.1 Joint environmental site inspections were conducted in the reporting period on 04, 10, 18, and 25 September 2025. The joint environmental site inspection was carried out by the representatives of the Engineer's Representative (ER), the Contractor, IEC and the ET on 10 September 2025. The joint environmental site inspection record is shown in **Appendix 9**. There was no noncompliance recorded during the site inspections.
- 6.1.2 Major findings and recommendations are summarized as follows:

04 September 2025

Opened cement bags were observed on the rooftop.

10 September 2025

• General waste was observed near the drainage system on the rooftop.

18 September 2025

Opened cement bags were observed at the upper rooftop.

25 September 2025

- A stock of more than 20 bags of cement was observed without covering by impervious sheets on LG.
- Waste was observed accumulated and had exceeded the capacity of the original sorting facilities on L1.

7 Environmental Non-conformance

7.1 Summary of Monitoring Exceedance

7.1 No exceedance of the Action and Limit Levels of construction noise was recorded at monitoring station during the reporting period.

7.2 Summary of Environmental Non-compliance

7.2.1 No non-compliance event was recorded during the reporting period.

7.3 Summary of Environmental Complaint

- 7.3.1 No environmental complaint was received during the reporting period. The cumulative statistic on environmental complaint is presented on **Table 7-1**.
- 7.3.2 The cumulative statistics on environmental complaints are presented in **Table 7-1**.

Table 7-1 Cumulative Statistics on Environmental Complaints

Reporting Period		Environmental Aspects				
		Air Quality	Noise	Water Quality	Waste	Ecology
September	Complaint Date	-	-	-	-	-
2025	No. of Complaint	0	0	0	0	0
Reporting Period Total		0	0	0	0	0
Accumulate of project		0	1*	0	0	0

Remarks:

7.3.3 Cumulative complaint / enquiry log, Summaries of complaints and enquiries are presented in **Appendix 12.**

7.4 Summary of Environmental Summons and Successful Prosecution

7.4.1 No summons and successful prosecution were received during the reporting period.

^{1. *} Equal to non-project related after the investigation.

8 Future Key Issues

8.1 Key Issues for the Coming Month

- 8.1.1 Works to be undertaken for the coming monitoring periods are summarized below:
 - Preparation works for Gov. inspection works
- 8.1.2 Potential environmental impacts arising from the above construction activities are mainly associated with dust, construction noise, site runoff and waste management.

8.2 Monitoring Schedule for the Next Month

8.2.1 The tentative schedule of noise monitoring for the next reporting period is presented in **Appendix 10**.

8.3 Construction Programme for the Next Month

8.3.1 The most updated construction programme for the Project is presented in **Appendix 1**.

9 Review of EM&A Data and EIA Predictions

9.1 Noise

9.1.1 The EIA predicted the construction noise levels during the day-time period. In this reporting period, superstructure construction, rebar fixing, formwork erection, and concreting works were conducted. Hence, a comparison between the measured noise results in this reporting month and predicted EIA noise levels was made. (**Table 9-1**).

Table 9-1 Comparison between the measured noise results and EIA predictions

Monitoring Station	EIA Predicted Construction	Baseline Noise Levels, dB(A)	Noise Monitoring Results, dB(A)		
	Noise Levels, dB(A)		Leq _(30mins) , Average	Range	
NM1	62	65.1	64.4	63 – 66	
NM2b	69	73.4	71.4*	69 – 73*	
NM3	66	69.8	66.2	66 – 67	

Note: * The measured noise levels at NM2b exceeded the noise level of 70 dB(A) on 01, 09, 22 and 30 September 2025, but they were lower than the baseline level of 73.4 dB(A) at NM2b. Therefore, they were not considered as Limit Level exceedances. As such the EAP was not triggered.

9.1.2 The comparison shows that the average of 30-minute construction noise levels recorded at all monitoring stations during the reporting period were higher than the EIA predicted construction noise levels but lower than the baseline noise levels. Recommended mitigation measures in **Section 5.8** of EIA will be implemented throughout the construction period.

9.2 Waste Management

9.2.1 The estimated amount of waste generated in this Project and the accumulated quantities of waste generated up to this reporting month are presented in **Appendix 8**. The amount of construction waste generated are minimal. Recommended mitigation measures in **Section 8.5** of the EIA will be implemented during the construction stage.

9.3 Conclusion of Review

9.3.1 The EIA predictions against the monitoring results since the commencement of construction works have been reviewed. The EIA concluded that the Project would not cause adverse impacts to the environment, and the monitoring results have also indicated the same so far. Mitigation measures recommended in the EP, EIA, EM&A Manual and the contract documents will continue to be implemented throughout the construction phase of the Project.


10 Conclusion

- 10.1.1 For construction noise, no Action or Limit Level exceedance was recorded at the monitoring stations during the reporting period.
- 10.1.2 Environmental site inspection was carried out on 04, 10, 18, and 25 September 2025. Recommendations on remedial actions were given to the Contractors for the deficiencies identified during the site inspections.
- 10.1.3 EPD general site inspection was not conducted in the reporting month. No special findings were identified.
- 10.1.4 No complaint was recorded during the reporting period.
- 10.1.5 No notification of summons and prosecution was received during the reporting period.
- 10.1.6 The ET will keep track on the EM&A programme to ensure compliance of environmental requirements and the proper implementation of all necessary mitigation measures.

Appendix 1

ract No. SS H504 (Programme No. 184GK)	d Vehicle I			3-Month Rolling Programme (08-20	020 to 10 2020)		
Task Name	Duration	Start	Finish Predecessors Successors Task % 2025 Calendar Complet	Jul	Aug	Sep M52	Oct
Contract Date	0 days	Thu 24/6/21	Thu 24/6/21 Calendar day 100%	M50	M5Ĭ	M52	M53
	.668.5 days						
Starting Date	0 days						
Access Date	0 days						
Original Contract Period (945 days after starting date)	0 days	Mon 19/2/24	Mon 19/2/24 3SS+946 days Calendar day 0%	i	i	i i	
Revised Contract Period (1302.5 days after starting date)	0 days	Tue 11/2/25	Tue 11/2/25 3SS+1303.5 da 7SS+365 days Calendar day 0%				
Defects Date	0 days	Wed 11/2/26	Wed 11/2/26 6SS+365 days Calendar day 0%	<u> </u>	+	<u>'</u>	
Major Submission Other than AIP/DDA	416 days	Tue 5/10/21	Thu 24/11/22 Calendar day 100%	I .			
Submission for Environmental Permit to EPD	77 days	Wed 27/10/21	Tue 11/1/22 Calendar day 100%				
Traffic Impact Assessment (TIA)	90 days			i	İ	i i	
Construction Traffic Impact Assessment (CTIA)	90 days	Tue 5/10/21	Sun 2/1/22 Calendar day 100%	 			
Submission to HKE for Transformer Room Layout		Wed 20/10/21					
Submission of GBP to Government Departments	142 days	Tue 16/11/21	Wed 6/4/22 Calendar day 100%				
BEAM Plus Project Assessment Process	340 days	Mon 20/12/21	Thu 24/11/22 Calendar day 100%				
Construction	1500 days	Mon 23/8/21	Tue 30/9/25 Calendar day 94%	1			1
Site Mobilization and Preparation	828 days	Wed 15/9/21	1				
Set up monitoring checkpoints (done on 29/10/21)	45 days	Wed 15/9/21	Fri 29/10/21 Calendar day 100%	i	İ	i i	
Ground Investigation Works (done on 23/10/21)	30 days		Thu 14/10/21 Calendar day 100%				
Set up revised hoarding	536 days		Thu 21/12/23 Calendar day 100%				
Erection of Tower Crane	76 days		Wed 18/10/23 Calendar day 100%	!	1	!	
Tree Removal and Preservation	296 days						
	1337 days		Mon 30/6/25 Calendar day 99%	i	İ	i i	
Piling Works	569 days	Tue 2/11/21					
Substructure Works	948 days				İ		
Zone A (near Sheung On Street)	378 days		-	!			
Zone B (near Sheung Tat Street)	337 days					1	
Zone C (near NWBF)	432 days			i	!	i	
U/G drainage connection and builder's work (started on 15/5/2							
Backfilling (include all zones)	694 days	Fri 4/8/23	· ·		i		
L1 slab construction (include all zones)	363 days				1		
Superstructure Works	580 days				 	1	
L1-L2 (started on 21/8/2023, done on 10/5/2024)	264 days					į	
L2-L3 (include L2M) (started on 15/3/2024, done on 15/6/2024)					I I		
	-					 	
L3-L3M (started on 15/5/2024, done on 12/7/2024)	59 days			1			
L3M-L4 (started on 20/5/2024, done on 14/8/2024)	87 days						
L4-L5 (started on 20/6/2024, done on 14/9/2024)	87 days			i	i i	i i	
L5-L6 (started on 23/8/2024, done on 17/10/2024)	56 days	Fri 23/8/24					
L6-L7 (started on 16/9/2024, done on 14/11/2024)	60 days						
L7-L8 (started on 23/10/2024, done on 12/12/2024)		Wed 23/10/24		The state of the s			
L8-R/F (started on 22/11/2024, done on 17/1/2024)	54 days		1 1				
R/F-UR/F (started on 18/12/2024, done on 22/3/2025)		Wed 18/12/24		i	i	i i	
Late cast portion	43 days						
L2 slab (started on 11/6/2024, done on 22/6/2024)	12 days						
L3 slab (started on 25/6/2024, done on 8/7/2024)	14 days			1			
L3M slab (started on 9/7/2024, done on 23/7/2024)	15 days	Tue 9/7/24	Tue 23/7/24 117 Calendar day 100%				
Off-Site Mock Up	223 days		Mon 14/11/22 Calendar day 100%	İ	İ	i i	
MiC Mock Up	-	Mon 10/10/22	-				
Architectural Works	409 days		-	i			1
Blockwall	300 days						
Door subframe	-		Thu 12/6/25 133SS+59 days Calendar day 100%	i i			
Window Frame / Glass Wall Bracket Fixing	240 days		Wed 18/6/25 133SS+65 days Calendar day 100%				
Ceiling plastering	270 days						
Wall plastering	320 days					1	
Waterproofing application	200 days						
Wall tiling (4.5.1.1 - 4.5.1.18)	-	Wed 13/11/24		i	i i	i i	
Window / Glass Wall / Cladding Fixing (4.2.1.1 - 4.2.1.30, 4.2.2.1 -	190 days	Wed 19/2/25	Wed 27/8/25 Calendar day 96%				
4.2.2.20) (include assumed 45 days inclement weather in 2024)	222	Wod 12/11/24	Tue 30/9/25 142SS+15 days Calendar day 92%			·	
Painting (4.5.1.1 - 4.5.1.18, 4.5.3.1 - 4.5.3.18) Floor screeding (4.5.2.1 - 4.5.2.18, 4.5.4.1 - 4.5.4.10)	322 days 310 days	Wed 13/11/24 Tue 29/10/24					
Floor finishes (4.5.2.1 - 4.5.2.18, 4.5.4.1 - 4.5.4.10) Floor finishes (4.5.2.1 - 4.5.2.18, 4.5.4.1 - 4.5.4.10, 4.5.5.1 - 4.5.5.10)							
Steel and metal work (4.4.2.1 - 4.4.2.30, 4.4.4.1 - 4.4.4.10, 4.7.3.1 -							
4.7.3.10, 6.1.4.1 - 6.1.4.10, 6.1.5.1 - 6.1.5.10, 6.1.6.1 - 6.1.6.10)	507 days	1110 20/11/24	days		İ	· · · · · · · · · · · · · · · · · · ·	
Timber doorset and Ironmongery installation (4.4.1.12 - 4.4.1.30)	90 days	Wed 26/3/25	Mon 23/6/25 Calendar day 100%			į	
Signage (4.9.1.1 - 4.9.1.10)	156 days			<u> </u>		 	
Fitting out works (4.7.1.1 - 4.7.1.10, 4.7.2.1 - 4.7.2.18)	212 days		-			-	
Sanitary fitting installation	65 days			!			
Roofing Works (4.6.1.1 - 4.6.1.20)	180 days		-			1	
External wall finishes (4.6.2.1 - 4.6.2.20)	170 days					i i	
Architectural Fins fixing	165 days			1	1		
External Work	295 days		Mon 21/7/25 Calendar day 100%	•	İ	i i	
Last Manhole Connection outside Site Boundary	286 days		-		I I		
Stage 1		Mon 30/9/24		•		1	
Mobilization (include forming recess for placing temp. steel	-		Tue 29/10/24 156 Calendar day 100%	i	1	i	
plate on existing carriageway)	55 days	30, 3/24	-, -, -, - 250 Calcilual day 20076		I I		
Excavation (include ELSW)	90 days	Wed 30/10/24	Mon 27/1/25 155 157SS+30 days Calendar day 100%		İ		
Construction of new manholes	90 days		Wed 26/2/25 156SS+30 days 158 Calendar day 100%	!	1		
Last Manhole to new M/Hs with T&C (subject to WSD's	118 days					,	
diversion of existing water main)	,5	. , _,			ļ.	į i	
Stage 2	24 days			1	I I		
Mobilization (include forming recess for placing temp. steel plate on existing carriageway)	7 days	Tue 13/5/25	Mon 19/5/25 161SS+3 days Calendar day 100%	1	I I		
	14.1	E:: 10 /F /0=	Thu 20/5/25 16000 2 days 16200 7 days 6 days 1 4000/		I I		
Excavation (include ELSW)	14 days				İ		
Connection between new M/Hs to existing M/Hs	14 days				1		
B . 1 CH:	14 days					,	
Backfilling		Wed 9/7/25	Sat 12/7/25 163 Calendar day 100%			i i	
Repaving	4 days			·			
-	27 days	Wed 25/6/25	Mon 21/7/25 Calendar day 100% Thu 17/7/25 158 1675S+10 days Calendar day 100%	•			

Appendix 2

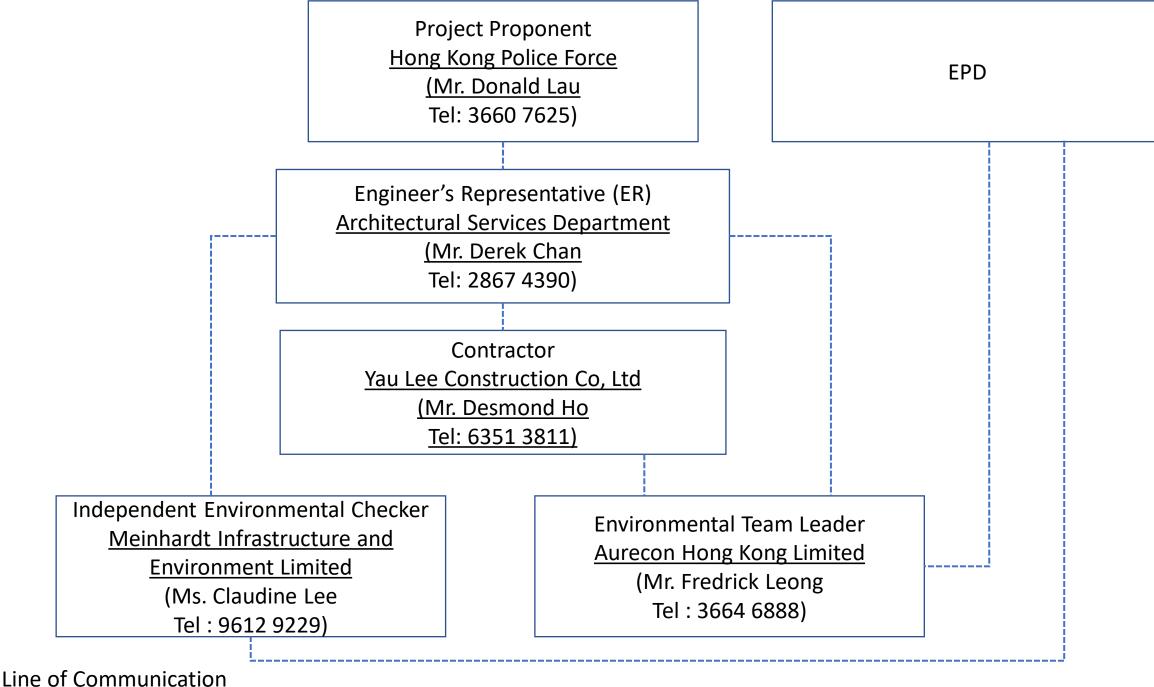

Key: ---- Line of Communication

Appendix 3

2025	Sept	embe	r			
MONDAY	TUESDAY	WEDNESDAY	THURSDAY	FRIDAY	SATURDAY	SUNDAY
O1 Noise Monitoring (NM1, NM2b and NM3)	02	03	04	05	06	07
08	09 Noise Monitoring (NM1, NM2b and NM3)	10	11	12	13	14
15	16 Noise Monitoring (NM1, NM2b and NM3)	17	18	19	20	21
Noise Monitoring (NM1, NM2b and NM3)	23	24	25	26	27	28
29	30 Noise Monitoring (NM1, NM2b and NM3)	01	02	03	04	05
06	07	Notes: The schedule is s etc.).	ubject to change du	ue to unforeseeable	e circumstances (e.g. a	adverse weather,

Appendix 4

Certificate of Calibration

for

Description:

Sound Level Meter

Manufacturer:

RION

Type No .:

NL-52 (Serial No.: 00331805)

Microphone:

UC-59 (Serial No.: 04870)

Preamplifier:

NH-25 (Serial No.:10403)

Submitted by:

Customer:

Envirotech Services Co.

Address:

Rm.712, 7/F., My Loft, 9 Hoi Wing Road,

Tuen Mun, Hong Kong

Upon receipt for calibration, the instrument was found to be:

☑ Within (31.5Hz – 8kHz)

☐ Outside

the allowable tolerance.

The test equipment used for calibration are traceable to National Standards via:

The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 19 May 2025

Date of calibration: 20 May 2025

Date of NEXT calibration: 19 May 2026

Calibrated by:____

Certified by:

Mr. Ng Yan Wa Laboratory Manager

Date of issue: 20 May 2025

Certificate No.: APJ25-026-CC001

age 1 of 4

Acoustics and Air Testing Laboratory Co. Ltd. 聲學及空氣測試實驗室有限公司

1. Calibration Precaution:

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.

2. Calibration Conditions:

Air Temperature:

24.7°**C**

Air Pressure:

1006 hPa

Relative Humidity:

56.2 %

3. Calibration Equipment:

Type

Serial No.

Calibration Report Number

Traceable to

Multifunction Calibrator

B&K 4226

2288467

AV240081

HOKLAS

4. Calibration Results

Sound Pressure Level

Reference Sound Pressure Level

Setting of Unit-under-test (UUT)		Applied value		UUT Reading,	IEC 61672 Class 1		
Range, dB	Freq. V	Veighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
30-130	dBA	SPL	Fast	94	1000	94.0	±0.4

Linearity

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
				94		94.0	Ref
30-130	dBA	SPL	Fast	104	1000	104.0	±0.3
	30 130 4511 512		- 114		114.0	±0.3	

Time Weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. We	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
20.120	ID.4	CDY	Fast	94	94 1000	94.0	Ref
30-130	30-130 dBA S	SPL	Slow			94.0	±0.3

Certificate No.: APJ25-026-CC001

A+A) Page 2 of 4

Frequency Response

Linear Response

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
				31.5	93.8	±2.0
				63	93.9	±1.5
	1 100	1 - 11	125	93.9	±1.5	
6.1207				250	93.9	±1.4
30-130	dB SPL	Fast	94	500	93.9	±1.4
	4: 7- 1: · ·	1.65		1000	94.0	Ref
		- 12 th - 12 th		2000	94.0	±1.6
				4000	94.4	±1.6
				8000	92.8	+2.1; -3.1

A-weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. V	Veighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
					31.5	54.3	-39.4 ±2.0
		14-13			63	67.8	-26.2 ±1.5
					125	77.9	-16.1 ±1.5
6 H 7 H 7					250	85.3	-8.6 ± 1.4
30-130	dBA	SPL	Fast	94	5 500	90.7	-3.2 ±1.4
					1000	94.0	Ref
					2000	95.2	+1.2 ±1.6
5741.3		34			4000	95.4	+1.0 ±1.6
					8000	91.8	-1.1+2.1; -3.1

C-weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
			- 1 1 1 1		31.5	90.7	-3.0 ±2.0
			- 1, , -,		63	93.1	-0.8 ± 1.5
			-	125	93.8	-0.2±1.5	
			250	93.9	-0.0 ± 1.4		
30-130	dBC	SPL	Fast	94	500	- 93.9	-0.0±1.4
					1000	94.0	Ref
					2000	93.8	-0.2 ±1.6
					4000	93.6	-0.8±1.6
			No. of the state o	8000	89.9	-3.0 +2.1: -3.1	

Certificate No.: APJ25-026-CC001





5. Calibration Results Applied

The results apply to the particular unit-under-test only. All calibration points are within manufacture's specification as IEC 61672 Class 1.

Uncertainties of Applied Value:

94 dB	31.5 Hz	± 0.10
	63 Hz	± 0.10
	125 Hz	± 0.10
	250 Hz	± 0.10
	500 Hz	± 0.05
	1000 Hz	± 0.05
	2000 Hz	± 0.10
	4000 Hz	± 0.05
	8000 Hz	± 0.10
104 dB	1000 Hz	± 0.05
114 dB	1000 Hz	± 0.05

The uncertainties are evaluated for a 95% confidence level.

Note:

The values given in this certification only related to the values measured at the time of the calibration and any uncertainties quoted will not allow for the equipment long-term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the calibration. (A+A)*L shall not be liable for any loss or damage resulting from the use of the equipment.

Page 4 of 4

Certificate No.: APJ25-026-CC001

Certificate of Calibration

Description:

Sound Level Calibrator

Manufacturer:

Larson Davis

Type No.:

CAL200

Serial No.:

10227

Submitted by:

Customer:

Envirotech Services Co.

Address:

Rm.712, 7/F., My Loft, 9 Hoi Wing Road,

Tuen Mun, Hong Kong

Upon receipt for calibration, the instrument was found to be:

✓ Within

☐ Outside

the allowable tolerance.

The test equipments used for calibration are traceable to National Standards via:

The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 12 February 2025

Date of calibration: 13 February 2025

Date of NEXT calibration: 12 February 2026

Calibrated by:

Calibration Technician

Date of issue: 13 February 2025

Certified by:

Mr. Ng Yan Wa Laboratory Manager

Certificate No.: APJ24-144-CC002

Page 1 of 2



1. Calibration Precautions:

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.

2. Calibration Specifications:

Calibration check

3. Calibration Conditions:

27.3 °C
1006 hPa
68.9 %

4. Calibration Equipment:

Test Equipment	Type	Serial No.	Calibration Report Number	Traceable to
Multifunction Calibrator	B&K 4226	2288467	AV240081	HOKLAS
Sound Level Meter	RION NA-28	30721812	AV240109	HOKLAS

5. Calibration Results

5.1 Sound Pressure Level

Nominal value dB	Accept lower level dB	Accept upper level dB	Measured value dB
94.0	93.6	94.4	94.1
114.0	113.6	114.4	114.4

6. Calibration Results Applied

The results apply to the particular unit-under-test only. All calibration points are within manufacture's specification as IEC 60942 Class 1.

Note:

The values given in this certification only related to the values measured at the time of the calibration.



Certificate No.: APJ24-144-CC002

Page 2 of 2

Appendix 5

Event and Action Plan for Construction Noise Monitoring

	Action					
	ET	IEC	ER	Contractor		
Action Level	 Notify the ER, IEC and Contractor. Carry out investigation. Report the results of investigation to the ER, IEC and Contractor. Discuss with the IEC and Contractor and formulate remedial measures. Increase monitoring frequency to check mitigation effectiveness. 	 Review the investigation results submitted by the ET. Review the proposed remedial measures by the Contractor and advise the ER accordingly. Advise the ER on the effectiveness of the proposed remedial measures. 	 Confirm receipt of notification of failure in writing. Notify the Contractor. Require the Contractor to propose remedial measures. Ensure remedial measures are properly implemented. 	 Submit noise mitigation proposals to the IEC and ER. Implement noise mitigation proposals 		
Limit Level	 Notify the ER, IEC, Contractor and EPD. Identify sources. Repeat measurements to confirm findings. Increase monitoring frequency. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented. Inform the IEC, ER and Contractor the causes and action taken for the exceedances. Assess the effectiveness of the Contractor's remedial action and keep the IEC, EPD and ER informed of the results. If exceedance stops, cease additional monitoring. 	 Discuss amongst the ER, ET and Contractor on the potential remedial action. Review the Contractor's remedial action whenever necessary to assure their effectiveness and advise the ER accordingly. 	notification of failure in writing. 2. Notify the Contractor. 3. Require the Contractor to propose remedial measures.	 Take immediate action to avoid further exceedance. Submit proposals for remedial action to the IEC and ER within 3 working days of notification. Implement the agreed proposals. Submit further proposals if problems still not under control. Stop the relevant portion of works as determined by the ER until the exceedance is abated. 		

Notes

- (1) ET Environmental Team, IEC Independent Environmental Checker;
- (2) Each step of action should be undertaken within 1 working day unless otherwise specified

Appendix 6

Implementation Schedule for Environmental Mitigation Measures (EMIS)

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
Air Qua	1				
4.8.2	2.3.1	Dust suppression measures stipulated in the Air Pollution Control (Construction Dust) Regulation and good site practices:	All work sites	Contractor and sub-contractor(s)	√
		Use of regular watering, to reduce dust emissions from exposed site surfaces and unpaved roads, particularly during dry weather;			
		Use of frequent watering for particularly dusty construction areas close to ASRs;			
		Side enclosure and covering of any aggregate or dusty material storage piles to reduce emissions. Where this is not practicable owing to frequent usage, watering should be applied to aggregate fines;			
		Open temporary stockpiles should be avoided or covered. Prevent placing dusty material storage plies near ASRs;			
		Tarpaulin covering of all dusty vehicle loads transported to, from and between site locations;			
		Establishment and use of vehicle wheel and body washing facilities at the exit points of the site;			
		Imposition of speed controls for vehicles on unpaved site roads. 8 km/hr is the recommended limit;			
		Routing of vehicles and positioning of construction plant should be at the maximum possible distance from ASRs;			
		• Every stock of more than 20 bags of cement or dry pulverised fuel ash (PFA), if applicable, should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 3-sides; and			
		Loading, unloading, transfer, handling or storage of large amount of cement or dry PFA should be carried out in a totally enclosed system or facility, and nay vent or exhaust should be fitted with the an effective fabric filter or			

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
		equivalent air pollution control system.			
Noise			L		
5.8.3	3.4.1 – 3.4.2	 Selection and Optimisation of Construction Processes Carefully arrange the timing and sequencing of the various construction activities according to the actual site work situation; Limit the quantity of PME to be operated concurrently; In the case during school examination, more stringent construction noise criteria should be imposed, the potentially most disruptive construction activities should be avoided, and arranged to be conducted during school holidays as far as practicable; and Preparation of the Construction Noise Management Plan. 	All work sites	Contractor and sub-contractor(s)	√ ·
5.8.4 – 5.8.6	3.4.1 – 3.4.2	Use of QPME and Quiet Working Methods In order to reduce the excessive noise impacts at the NSRs, quieter PME are recommended. Whilst quieter PME are listed, the Contractor may be able to obtain particular models of plant that are quieter than the PMEs given in GW-TM. The associated mitigation measures to the particular PME should be reviewed by the Contractor. The use of plants with SWLs less than those in the GW-TM are summarized in <i>Table 5.14</i> of the EIA report and the proposed mitigated plant inventory for the	All work sites	Contractor and sub-contractor(s)	1

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
		construction works of the proposed Project is detailed in <i>Appendix 5.8</i> .			
5.8.7 – 5.8.8	3.4.1 – 3.4.2	Use of movable noise barriers	All work sites	Contractor and sub-contractor(s)	√
		The use of movable noise barrier for certain PME could further minimize the			
		construction noise impact. In general 5dB(A) reduction for mobile PME and			
		10dB(A) for stationary PME can be achieved provided that the direct line-of site			
		of the PME is blocked. The Contractor shall be responsible for the design of the			
		movable noise barrier with due consideration given to the size of the PME and the			
		requirement of intercepting the line of sight between the NSRs and the PME, as			
		well as ensuring that the barriers should have no openings and gaps.			
5.8.9	3.4.1 –	Good site practices	All work sites	Contractor and	√
	3.4.2	Use of well-maintained and regularly-serviced plant during the works;		sub-contractor(s)	
		Plant operating on intermittent basis should be turned off or throttled down to a minimum;			
		Plant known to emit noise strongly in one direction should be orientated to face away from the NSRs;			
		• Silencers, mufflers and enclosures for plant should be used where possible and properly maintained throughout the works;			
		Where possible fixed plants should be sited away from NSRs; and			
		Stockpiles of excavated materials and other structures such as site buildings should be used effectively to screen noise from the works.			

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
Water Q	uality & Se	werage			
6.9.1	4.4.2	In accordance with Professional Persons Environmental Consultative Committee Practice Notes (ProPECC PN) 1/94, potential water quality impact shall be minimised by the implementation of construction phase mitigation measures and general good site practice including the following:	All work sites	Contractor and sub-contractor(s)	√
		• At the establishment of works site, perimeter cut-off drains to direct off-site water around the Site should be constructed with internal drainage works and erosion and sedimentation control facilities implemented. Channels (both temporary and permanent drainage pipes and culverts), earth bunds or sand bag barriers should be provided to divert the stormwater to silt removal facilities.			
		Dikes or embankments for flood protection should be implemented around the boundaries of earthwork areas. Temporary ditches should be provided to facilitate the run-off discharge into an appropriate watercourse, through a silt/sediment trap. Silt/sediment traps should also be incorporated in the permanent drainage channels to enhance deposition rates;			
		• The design of efficient silt removal facilities should be based on the guidelines in Appendix A1 of ProPECC PN 1/94, which states that the retention time for silt/sand traps should be 5 minutes under maximum flow conditions. The sizes may vary depending upon the flow rate, but for a flow rate of 0.1m³/s, a sedimentation basin of 30m³ would be required and for a			

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
		flow rate of 0.5m³/s the basin would be 150m³. The detailed design of the sand/silt raps should be undertaken by the Contractor prior to the commencement of construction.			V
		• The construction works should be programmed to minimise surface excavation works during rainy seasons (April to September), as possible. All exposed earth areas should be completed and vegetated as soon as possible after completion of the earthwork, or alternatively, within 14 days of the cessation of earthworks where practicable. If excavation of soil cannot be avoided during the rainy season, or at any time of year when rainstorms are likely, exposed slope surfaces should be covered by tarpaulin or other means;			
		• The overall slope of works sites should be kept to a minimum to reduce the erosive potential of surface water flows, and all trafficked areas and access roads should be protected by coarse stone ballast. An additional advantage accruing from the use of crushed stone is the positive traction gained during the prolonged periods of inclement weather and the reduction of surface sheet flows;			
		 All drainage facilities and erosion and sediment control structures should be regularly inspected and maintained to ensure their proper and efficient operation at all times particularly following rainstorms. Deposited silts and grits should be removed regularly and disposed of by spreading evenly over stable, vegetated areas; 			
		 Measures should be taken to minimise the ingress of site drainage into excavations. If the excavation of trenches in wet season is inevitable, they should be dug and backfilled in short sections wherever practicable. The water pumped out from trenches or foundation excavations should be discharged into storm drains via silt removal facilities; 			
		All open stockpiles of construction materials (for example, aggregates, sand and fill materials) should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system;			
		Manholes (including newly constructed ones) should always be adequately covered and temporarily sealed so as to prevent silt, construction materials			

EIA Ma	M&A anual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
		 or debris being washed into the drainage system and storm run-off being directed into foul sewers; Precautions to be taken at any time of the year when rainstorms are likely, actions to be taken when a rainstorm is imminent or forecasted and during or after rainstorms, are summarised in Appendix A2 of ProPECC PN 1/94. Particular attention should be paid to the control of silty surface run-off during storm events; All vehicles and plants should be cleaned before leaving the Project site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and sited wheel washing bay should be provided at the exit of Project site where practicable. Wash-water should have sand and silt settled out and removed at least on a weekly basis to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel-washing bay to public roads should be paved with sufficient backfall toward the wheel-washing bay to prevent vehicle tracking of soil and silty water to public roads and drains; Oil interceptors should be provided in the drainage system downstream of any oil/fuel pollution sources. Oil interceptors should be emptied and cleaned regularly to prevent the release of oil and grease into the storm water drainage system after accidental spillage. A bypass should be provided for oil interceptors to prevent flushing during heavy rain. Any drainage channels connecting storm drains via designed sand/silt removal facilities should be disconnected/removed after completion of construction stage to prevent any direct discharge to the stormwater system; The construction solid waste, debris and rubbish on-site should be collected, handled and disposed of properly to avoid causing any water quality impacts. The requirements for solid waste management are detailed in Section 8 of EIA report; and All fuel tanks and storage areas should be provided with locks and sited on sealed areas, within bunds of a c			

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
6.9.3	4.4.3	There is a need to apply to the EPD for a discharge licence for discharge of effluent from the construction site under the WPCO. The discharge quality must meet the requirements as specified in the discharge licence. All the run-off and wastewater generated from the works areas should be treated so that it satisfies all the standards listed in the Technical Memorandum. Minimum distances of 100 m should be maintained between the discharge points of construction site effluent and the existing seawater intakes. In addition, no new effluent discharges in nearby typhoon shelters should be allowed. The beneficial uses of the treated effluent for other on-site activities such as dust suppression, wheel washing and general cleaning etc., would minimise water consumption and reduce the effluent discharge volume.	All work sites	Contractor and sub-contractor(s)	√ ·
6.9.4	4.4.4	Portable chemical toilets and sewage holding tanks are recommended for the handling of the construction sewage generated by the workforce. A licenced contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance.	All work sites	Contractor and sub-contractor(s)	V
6.9.6	4.4.5	Any maintenance facilities should be located on hard standings within a bunded area, and sumps and oil interceptors should be provided. Maintenance of vehicles and equipment involving activities with potential for leakage and spillage should be undertaken within the areas appropriately equipped to control these discharges.	All work sites	Contractor and sub-contractor(s)	√ ·
6.9.7	4.4.6	All sewage arising from the proposed Project should be collected and diverted to the public foul water drainage system via proper connections to minimise water quality impact from the operation of the Project and ensure compliance with Technical Memorandum on Standards for Effluents Discharged into Drainage and Sewerage Systems, Inland and Coastal Waters under the Water Pollution Control Ordinance (WPCO-TM).	The Government Complex and Vehicle Depot	Contractor and sub-contractor(s), HKPF, FEHD, EMSD and GL	V
6.9.8	4.4.7	Run-offs from the covered areas including vehicle washing bays and vehicle examination / maintenance / repair / testing area would be properly treated prior to discharge into the foul water drainage system. The wastewater treatment	The Government Complex and Vehicle Depot	Contractor and sub-contractor(s)	√

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
		facilities for the proposed Project, which comprised of petrol interceptor and sedimentation tank, would be designed using sedimentation process with adequate treatment capacity. Oily waste collected by petrol interceptors is considered and disposed of as chemical waste. The wastewater treatment facilities for the proposed Project will be designed during the detailed design stage and the treated effluent for discharging into the public foul water drainage system should comply with the effluent standards as stated in the WPCO-TM.			
Landsca	pe and Visu	al			
7.8.2	5.2.1	Hoardings should be provided with aesthetic treatment and designed to be subtle and camouflaged. It should be compatible with the surrounding landscape and visually "impermeable" to block the view of construction activities from VSRs.	All work sites	Contractor and sub-contractor(s)	V
7.8.3	5.2.1	Temporary landscape treatment, such as the provision of temporary landscape planting around the Site office in ornamental pots and application of green roof for Site office, should be considered during construction phase. Landscape planting in movable planters should also be considered as a temporary greening measure for the Project area (i.e. along Site hoarding). Design of the green roof and the type of species to be used shall be reviewed and confirmed during detailed design stage.	All work sites	Contractor and sub-contractor(s)	N/A

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
7.8.4	5.2.1	Disturbance to existing vegetation should be avoided as far as practicable. Where possible, the construction programme should retain all trees in situ that are not in direct conflict with the development proposals. Subject to the detailed design of the proposed Project, a review shall be carried out before commencement of construction phase to assess the potential conflict of the construction activities with existing roadside trees and the need of corresponding measures. Proper protective fencing should be provided by the Contractor to protect the preserved trees before commencement of any works within the Project site. The protective fencing should be erected along or beyond the perimeter of the tree protection zone of each individual tree.	All work sites	Contractor and sub-contractor(s)	

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
7.8.7	5.2.1	A multi-patch of landscape area should be provided on the roof of the proposed building to soften the impact of the built structure. An area of approximately 2600m² of shrub, which comprises of a mix of native and ornamental species, is proposed to be provided to enhance the aesthetics of views for those viewing the roof. The type of shrub species will be confirmed during detailed design stage. The planting should be commenced during construction stage and be completed before the completion of construction stage to ensure the measure will be implemented on Day 1 of operation stage. Vegetation maintenance should be provided by the Operator.	The Government Complex and Vehicle Depot	Contractor and sub-contractor(s), Operator	N/A
7.8.8 7.8.9	5.2.1	The exterior of the permanent structure of the proposed Project should use non-reflective external finishes in light colour that is visually unobtrusive with surrounding context. Non-reflective paving materials should be considered to reduce potential glare from surface reflectance. The finishing material and colour will be reviewed and confirmed during detailed design stage. Lighting should be efficiently designed so that minimum amount of lighting is required for safety and security. The design may make reference to the Guidelines on Industry Best Practices for External Lighting Installations by Environmental Bureau, EPD and EMSD. The mounting height and direction of exterior lighting fixtures shall be designed and arranged to point away from sensitive receivers where possible. Specification of lighting operation schedule shall be formed by the operator to impose restriction on lighting operation after business hours, such as limiting the operation of lighting except for security lighting only, and in areas with necessary night-time operation where applicable.	The Government Complex and Vehicle Depot	Contractor and sub-contractor(s), Operator	N/A

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
8.5.1	6.2.1	 Recommendations for good site practices: The Contractor shall prepare a Waste Management Plan (WMP) in accordance with the requirements set out in the ETWB TCW No. 19/2005, Waste Management on Construction Site, for the Engineer's Representative approval. The WMP shall include monthly and yearly Waste Flow Tables that indicate the amounts of waste generated, recycled and disposed of (including final disposal site); The Contractor's waste management practices and effectiveness shall be audited by the Engineer's Representative on regular basis; The Contractor shall provide training for site staff for the concept of site cleanliness and appropriate waste management procedures, including waste reduction, reuse and recycling; 	All works sites	Contractor and Sub-contractors	V
		 The Contractor shall ensure sufficient waste disposal points and regular collection of waste; The Contractor shall use trucks with covering for the open-box bed and enclosed container shall be used to minimise windblown litter and dust during transportation of waste; The Contractor shall implement regular cleaning and maintenance programme for drainage systems, pumps and oil interceptors; Separation of chemical wastes for special handling and appropriate treatment at a Chemical Waste Treatment Facility (CWTF); Encourage collection of aluminium cans, paper and plastic bottles by providing separate labelled bins to enable these wastes to be segregated from other general refuse generated by the workforce; Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal; Wheel washing facilities shall be used by all trucks leaving the site to prevent transfer of mud onto public roads; 			

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
		Make provisions in contract documents to allow and promote the use of recycled aggregates where appropriate;			\checkmark
		 No waste shall be burnt on-site; A recording system for the amount of wastes generated, recycled and disposed (including disposal sites) should be proposed; 			
		Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste; and			
		 Adequate numbers of portable toilets should be provided for on-site workers. Portable toilets should be maintained in reasonable states, which will not deter the workers form utilizing them. Night soil should be regularly collected by licensed collectors. 			
8.5.1	6.2.1	C&D Materials / Waste:	All work sites	Contractor and	√
		Use standard formwork or pre-fabrication as far as practicable so as to minimise the C&D Materials arising;		Sub-contractors	
		Consider the use of more durable formwork or plastic facing for construction works;			
		Avoid the use of wooden hoardings and substitute with metal hoarding to facilitate recycling;			
		Purchase of construction materials should be carefully planned in order to avoid over-ordering and wastage;			
		• Establish a trip-ticket system in accordance with DevB TC(W) No. 6/2010 and Waste Disposal (Charges for Disposal of Construction Waste) Regulation in order to monitor the disposal of inert C&D Materials at public fill and the remaining C&D Waste to landfills, and control flytipping;			
		Design foundation works to minimise the amount of excavated material to be generated;			
		Sort construction debris and excavated materials on-site to recover			

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
		reusable/recyclable portions (i.e. soil, broken concrete, metal, etc.) for backfilling and reinstatement; • Segregate and store different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal; • Specify in design & build contract the use of recycled aggregates where appropriate; • Plan and stock construction materials carefully to minimise the amount of waste to be generated and to avoid unnecessary generation of waste; and • Recommend the use of metal fencing or building panels, which are more durable than wooden panels, for the erection of construction site hoarding.			
8.5.1	6.2.1	 Chemical waste: Chemical waste producers should be registered with the EPD; Chemical waste should be handled in accordance with the "Code of Practice on the Packaging, Handling and Storage of Chemical Wastes" including but not limited to the followings: Good quality containers compatible with the chemical wastes should be used and maintained in good conditions and securely closed, with incompatible chemicals be stored separately. Appropriate labels should be securely attached on each chemical waste container in English and Chinese according to the instructions prescribed in Schedule 2 of the Regulations. A licensed collector to transport and dispose of the chemical wastes should be employed by the Contractor, to either the Chemical Waste Treatment Centre at Tsing Yi, or any other licensed facilities. Waste oils, chemicals or solvents should not be discharged to drain; and Routine cleaning and maintenance programme for drainage systems, sumps 	The Government Complex and Vehicle Depot	Contractor and Sub-contractor; HKPF, FEHD, EMSD and GL	

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures and oil interceptors during operation.	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
8.5.1	6.2.1	 General refuse: Sufficient dustbins should be provided for storage of waste as required under the Public Cleansing and Prevention of Nuisances By-laws; Sufficient enclosed bins should be provided for general refuse, food and beverage waste to reduce odour, pest and litter impacts; General refuse arising on-site should be stored in enclosed bins or compaction units separately from C&D and chemical wastes; A reliable waste collector should be employed to clear general refuse from the construction site on a daily basis and disposed of to the licensed landfill or refuse transfer station; Office wastes can be reduced by recycling of paper if such volume is sufficiently large to warrant collection. Participation in a local collection scheme by the Contractor should be advocated; and Waste separation facilities for paper, aluminium cans, plastic bottles, etc. should be provided on-site and collected by individual collectors should be encouraged. 	The Government Complex and Vehicle Depot	Contractor and Sub-contractor; HKPF, FEHD, EMSD and GL	√ ·
10.11.1	8.2.1	Recommendations for good site practices in construction phase: • ignition of fire on site should be controlled throughout the construction programme; • any temporary storage of fuel and flammable chemical should be minimised to reduce chance of causing explosion or escalation of fire in the case of emergency event at nearby potentially hazardous sources;	All works area	Contractor and sub-contractors	V

EIA Ref.	EM&A Manual Ref.	Environmental Protection Measures	Location/ Duration of Measures/ Timing of Completion of Measures	Implementation Agent	Status
		fire extinguisher or other firefighting equipment should be made easily accessible to on-site workers; and			
		establish communication channel and evacuation plan in the case of emergency event at nearby potentially hazardous sources.			

Remark:

- √ Compliance of Mitigation Measures
- <> Compliance of Mitigation but need improvement
- x Non-compliance of Mitigation Measures
- ▲ Non-compliance of Mitigation Measures but rectified by Yau Lee Construction, Co, Ltd

 Δ Deficiency of Mitigation Measures but rectified by Yau Lee Construction, Co, Ltd

N/A Not Applicable in Reporting Period

Appendix 7

Contract No. SS H504 Design and Construction of Chai Wan Government Complex and Vehicle Depot Noise Monitoring Data


2025-09-01 NM2b * 11:38 2025-09-01 NM3 11:00 2025-09-09 NM1* 13:00 2025-09-09 NM3 11:00 2025-09-16 NM1* 15:31 2025-09-16 NM2b * 14:55 2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b * 10:55 2025-09-22 NM2b * 10:55	13:00 11:38 11:00	0.3	Leq: L10: L90:	63.6			Sid set Sii	nins, dB(A)	4th set 5n	nins, dB(A)	5th set 5n	nins, dB(A)	6th set 5n	nins, dB(A)	[Construction Leq 30m	Noise Level], ins, dB(A)	Unit	Site Observation	Construction Noise Level #	Unit	
2025-09-01 NM2b * 11:38 2025-09-01 NM3 11:00 2025-09-09 NM1* 13:00 2025-09-09 NM2b * 11:38 2025-09-09 NM3 11:00 2025-09-16 NM1* 15:31 2025-09-16 NM2b * 14:55 2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b * 10:55 2025-09-22 NM2b * 10:55	11:38			67.1	Leq: L10:	64.2 66.8	Leq: L10:	63.1 66.1	Leq: L10:	62.6 65.1	Leq: L10:	62.7 66.5	Leq: L10:	64.1 66.9	Leq:	63	dB(A)	Major: Noise from Yau Lee Site	N.A.	dB(A)	
2025-09-01 NM3 11:00 2025-09-09 NM1* 13:00 2025-09-09 NM2b* 11:38 2025-09-09 NM3 11:00 2025-09-16 NM1* 15:31 2025-09-16 NM3 13:26 2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b* 10:55 2025-09-22 NM2b* 10:55	11:00	0.2		59.2	L90:	58.6	L90:	59.1	L90:	58.7	L90:	57.9	L90:	59.1			(-,	Other: Railway Noise and Traffic Noise.		(-,	
2025-09-01 NM3 11:00 2025-09-09 NM1* 13:00 2025-09-09 NM2b* 11:38 2025-09-09 NM3 11:00 2025-09-16 NM1* 15:31 2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b* 10:55 2025-09-22 NM2b* 10:55	11:00	0.2	Leg:	74.2	Lea:	72.5	Leg:	72.1	Lea:	72.4	Leg:	72.4	Leg:	73.1				M M			
2025-09-09 NM1* 13:00 2025-09-09 NM2b* 11:38 2025-09-09 NM3 11:00 2025-09-16 NM1* 15:31 2025-09-16 NM3 13:26 2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b* 10:55			L10:	76.4	L10:	76.0	L10:	73.9	L10:	74.8	L10:	74.5	L10:	75.8	Leq:	73	dB(A)	Major: Noise from Yau Lee Site Other: Traffic Noise.	N.A.	dB(A)	
2025-09-09 NM1* 13:00 2025-09-09 NM2b* 11:38 2025-09-09 NM3 11:00 2025-09-16 NM1* 15:31 2025-09-16 NM2b* 14:55 2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b* 10:55 2025-09-22 NM3 10:00			L90:	68.4	L90:	68.5	L90:	69.1	L90:	69.5	L90:	69.4	L90:	68.6				Other, Harric Noise.			
2025-09-09 NM1* 13:00 2025-09-09 NM2b* 11:38 2025-09-09 NM3 11:00 2025-09-16 NM1* 15:31 2025-09-16 NM2b* 14:55 2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b* 10:55 2025-09-22 NM3 10:00			Leq:	64.9	Leq:	65.3	Leq:	66.4	Leq:	67.0	Leq:	65.9	Leq:	66.5				Major: Noise from Yau Lee Site			
2025-09-09 NM2b * 11:38 2025-09-09 NM3 11:00 2025-09-16 NM1* 15:31 2025-09-16 NM2b * 14:55 2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b * 10:55 2025-09-22 NM3 10:00	13:00	0.3	L10:	66.2	L10:	66.6	L10:	67.9	L10:	68.7	L10:	67.9	L10:	68.0	Leq:	66	dB(A)	Other: Noise from Cargo Handling Area.	N.A.	dB(A)	
2025-09-09 NM2b * 11:38 2025-09-09 NM3 11:00 2025-09-16 NM1* 15:31 2025-09-16 NM2b * 14:55 2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b * 10:55 2025-09-22 NM3 10:00	13:00		L90:	63.4	L90:	63.7	L90:	64.3	L90:	64.8	L90:	63.8	L90:	64.2						Ļ	
2025-09-09 NM2b * 11:38 2025-09-09 NM3 11:00 2025-09-16 NM1* 15:31 2025-09-16 NM2b * 14:55 2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b * 10:55 2025-09-22 NM3 10:00	13:00		Leq:	65.3	Leq:	64.3	Leq:	65.8	Leq:	66.3	Leq:	66.3	Leq:	66.9	_			Major: Noise from Yau Lee Site			
2025-09-09 NM3 11:00 2025-09-16 NM1* 15:31 2025-09-16 NM2b * 14:55 2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b * 10:55 2025-09-22 NM3 10:00		0.3	L10:	68.2	L10:	65.2	L10:	69.7	L10:	69.6	L10:	69.3	L10:	69.4	Leq:	66	dB(A)	Other: Railway Noise and Traffic Noise.	58.12	dB(A)	
2025-09-09 NM3 11:00 2025-09-16 NM1* 15:31 2025-09-16 NM2b * 14:55 2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b * 10:55 2025-09-22 NM3 10:00			L90:	60.9	L90:	59.5	L90:	58.1	L90:	61.5	L90:	60.9	L90:	61.6				· ·		├	
2025-09-09 NM3 11:00 2025-09-16 NM1* 15:31 2025-09-16 NM2b * 14:55 2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b * 10:55 2025-09-22 NM3 10:00	11.20	0.3	Leq:	71.2	Leq:	70.9	Leq:	71.6	Leq:	71.7	Leq:	70.3	Leq:	70.4	Leg:	71	dB(A)	Major: Noise from Yau Lee Site	N.A.	dB(A)	
2025-09-16 NM1* 15:31 2025-09-16 NM2b* 14:55 2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b* 10:55 2025-09-22 NM3 10:00	11.50	0.5	L10: L90:	75.4 62.3	L10: L90:	74.1 62.6	L10: L90:	74.7 63.6	L10: L90:	75.3 64.9	L10:	73.6 63.4	L10: L90:	74.1 63.9	Leq.	/1	UB(A)	Other: Traffic Noise.	N.A.	UD(A)	
2025-09-16 NM1* 15:31 2025-09-16 NM2b* 14:55 2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b* 10:55 2025-09-22 NM3 10:00			Lea:	66.3	Lea:	65.0	Lea:	65.3	Lea:	65.4	Lea:	65.3	Lea:	66.3						\vdash	
2025-09-16 NM1* 15:31 2025-09-16 NM2b* 14:55 2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b* 10:55 2025-09-22 NM3 10:00	11:00	0.3	LEQ:	67.6	Leq: L10:	66.5	Leq: L10:	66.5	LEQ:	66.5	L10:	66.6	Leq: L10:	67.0	Leg:	66	dB(A)	Major: Noise from Yau Lee Site	N.A.	dB(A)	
2025-09-16 NM2b * 14:55 2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b * 10:55 2025-09-22 NM3 10:00			L90:	64.5	L90:	63.5	L90:	63.7	L90:	64.0	L90:	63.9	L90:	64.3			(-,	Other: Noise from Cargo Handling Area.		(-,	
2025-09-16 NM2b * 14:55 2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b * 10:55 2025-09-22 NM3 10:00		1	Lea:	62.8	Lea:	62.6	Leg:	62.2	Lea:	63.7	Lea:	65.7	Leg:	63.2							
2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b* 10:55 2025-09-22 NM3 10:00	15:31	0.7	LEQ.	65.6	L10:	66.6	L10:	65.2	L10:	66.4	L10:	67.9	L10:	65.9	Leg:	64	dB(A)	Major: Noise from Yau Lee Site	N.A.	dB(A)	
2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b* 10:55 2025-09-22 NM3 10:00			L90:	58.6	L90:	57.6	L90:	57.8	L90:	58.3	L90:	60.0	L90:	58.1	·			Other: Railway Noise and Traffic Noise.			
2025-09-16 NM3 13:26 2025-09-22 NM1* 11:30 2025-09-22 NM2b* 10:55 2025-09-22 NM3 10:00			Leg:	68.2	Lea:	68.3	Leg:	67.9	Leg:	68.9	Leg:	68.5	Leg:	69.3							
2025-09-22 NM1* 11:30 2025-09-22 NM2b * 10:55 2025-09-22 NM3 10:00	14:55	0.4	L10:	71.8	L10:	70.8	L10:	71.3	L10:	71.4	L10:	72.5	L10:	72.4	Leq:	69	dB(A)	Major: Noise from Yau Lee Site Other: Traffic Noise.	N.A.	dB(A)	
2025-09-22 NM1* 11:30 2025-09-22 NM2b * 10:55 2025-09-22 NM3 10:00			L90:	61.9	L90:	62.4	L90:	62.6	L90:	62.8	L90:	61.0	L90:	61.4				Other: Traffic Noise.			
2025-09-22 NM1* 11:30 2025-09-22 NM2b * 10:55 2025-09-22 NM3 10:00			Leq:	66.8	Leq:	65.7	Leq:	66.1	Leq:	65.1	Leq:	65.2	Leq:	66.9				Major: Noise from Yau Lee Site			
2025-09-22 NM2b * 10:55 2025-09-22 NM3 10:00	13:26	0.5	L10:	70.0	L10:	66.8	L10:	67.8	L10:	66.9	L10:	68.0	L10:	69.0	Leq:	66	dB(A)	Other: Noise from Cargo Handling Area.	N.A.	dB(A)	
2025-09-22 NM2b * 10:55 2025-09-22 NM3 10:00			L90:	64.9	L90:	64.5	L90:	63.6	L90:	63.7	L90:	64.1	L90:	65.0				other. Holse from eargo righting rives.		↓	
2025-09-22 NM2b * 10:55 2025-09-22 NM3 10:00			Leq:	65.5	Leq:	62.7	Leq:	61.8	Leq:	63.3	Leq:	62.5	Leq:	64.5	_			Major: Noise from Yau Lee Site			
2025-09-22 NM3 10:00	11:30	0.5	L10:	67.1	L10:	66.6	L10:	65.2	L10:	66.2	L10:	65.3	L10:	67.7	Leq:	64	dB(A)	Other: Railway Noise and Traffic Noise.	N.A.	dB(A)	
2025-09-22 NM3 10:00			L90:	58.2 73.9	L90:	56.8 73.4	L90:	55.3 71.6	L90:	56.5 73.5	L90:	57.4 72.8	L90:	57.3 73.5				·		├	
2025-09-22 NM3 10:00	10.55	0.3	Leq: L10:	76.9	Leq: L10:	76.0	Leq: L10:	73.8	Leq: L10:	76.5	Leq: L10:	76.5	Leq: L10:	76.9	Leg:	73	dB(A)	Major: Noise from Yau Lee Site	N.A.	dB(A)	
	10.55	0.5	L90:	71.1	L90:	69.2	L90:	67.3	L90:	68.3	L90:	68.5	L90:	68.3	Leq.	,,,	GD(71)	Other: Traffic Noise.	14.5 G	ub(//)	
			Lea:	67.8	Lea:	67.6	Lea:	66.3	Lea:	66.1	Lea:	66.5	Lea:	66.6							
2025 00 20 NAM* 44-20	10:00	0.3	L10:	68.4	L10:	68.8	L10:	67.2	L10:	67.1	L10:	67.4	L10:	67.7	Leq:	67	dB(A)	Major: Noise from Yau Lee Site	N.A.	dB(A)	
707F 00 20 NA41* 11/20			L90:	65.5	L90:	65.8	L90:	65.1	L90:	65.0	L90:	65.2	L90:	65.3				Other: Noise from Cargo Handling Area.			
202F 00 20 NA44* 44-20			Leq:	65.1	Leq:	64.0	Leq:	65.6	Leq:	63.3	Leq:	63.8	Leq:	66.4				Major: Noise from Yau Lee Site			
2025-09-30 NIVIT 11:30	11:30	0.5	L10:	68.3	L10:	65.9	L10:	69.0	L10:	66.1	L10:	66.9	L10:	67.9	Leq:	65	dB(A)	Other: Railway Noise and Traffic Noise.	N.A.	dB(A)	
			L90:	59.1	L90:	59.2	L90:	60.1	L90:	59.7	L90:	59.3	L90:	59.0				odici. Naliway Noise and Traine Noise.		<u> </u>	
			Leq:	71.8	Leq:	71.7	Leq:	71.0	Leq:	71.5	Leq:	69.7	Leq:	71.2				Major: Noise from Yau Lee Site			
2025-09-30 NM2b * 10:55		0.3	L10:	75.0	L10:	75.6	L10:	74.1	L10:	74.7	L10:	73.6	L10:	74.9	Leq:	71	dB(A)	B(A) Other: Traffic Noise.	N.A.	N.A.	dB(A)
	10:55	+	L90:	64.9	L90:	63.2	L90:	64.7	L90:	63.9	L90:	63.3	L90:	63.5				Other, frame Noise.		├	
2025-09-30 NM3 10:00	10:55	0.3	Leq: L10:	67.0 68.1	Leq: L10:	66.3 67.3	Leq: L10:	66.5 67.9	Leq: L10:	65.2 66.4	Leq: L10:	65.7 66.8	Leq: L10:	65.6 66.9	Leq: 66 dB(A)	Major: Noise from Yau Lee Site	Major: Noise from Yau Lee Site	N.A.	dB(A)		
2023-03-30 NIVIS 10:00	10:55	0.5	L10: L90:	65.4	L10: L90:	65.1	L10:	64.9	L10: L90:	63.9	L10:	64.2	L10: L90:	63.9	Leq:	00	UD(A)	dB(A) Other: Noise from Cargo Handling Area.	IN.A.	ub(A)	


Remark:


^On 1, 9, 22, and 30 September 2025, the measured noise levels of NM2b exceeded the limit level of 70dB(A). However, they were lower than the baseline level of 73.4 dB(A). Therefore, they are not considered as an limit level exceedance.

#The measured noise level was higher than the baseline level at NM1. Therefore, baseline corrections were carried out and the corrected noise level which solely represent the noise level of Construction works are lower than the noise criteria. As such the EAP was not triggered.

^{*} A facade correction of +3 dB(A) was applied to the measured noise level.

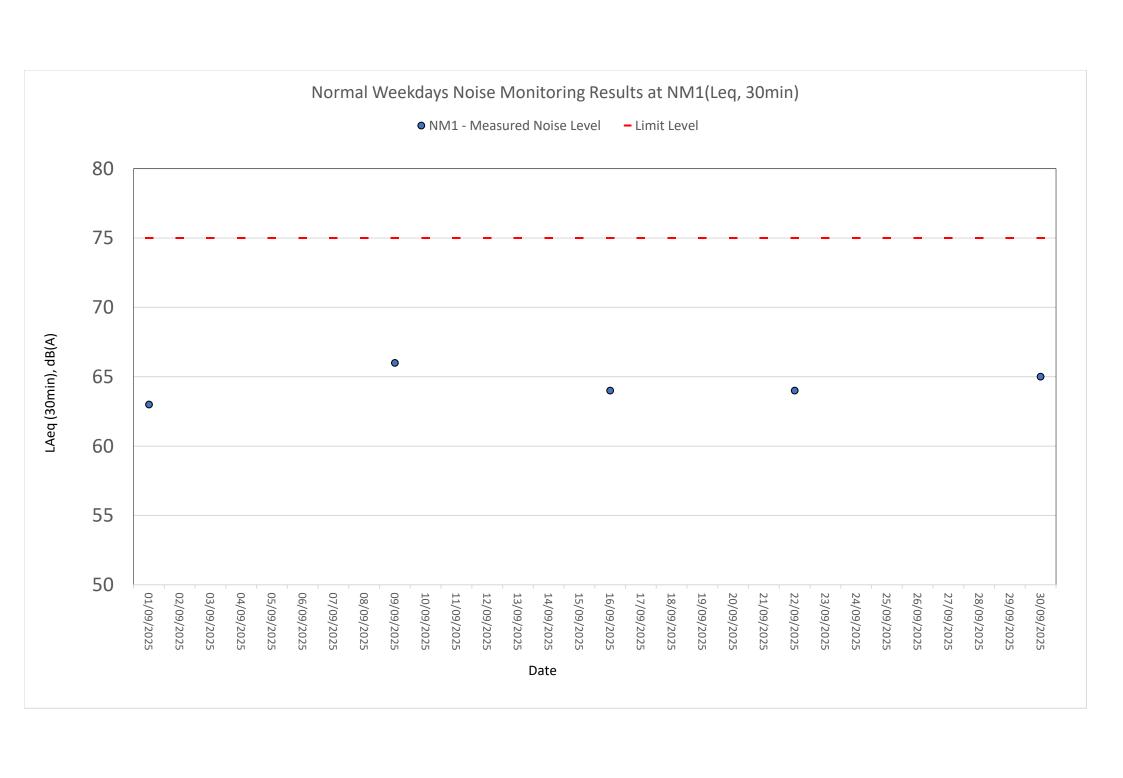

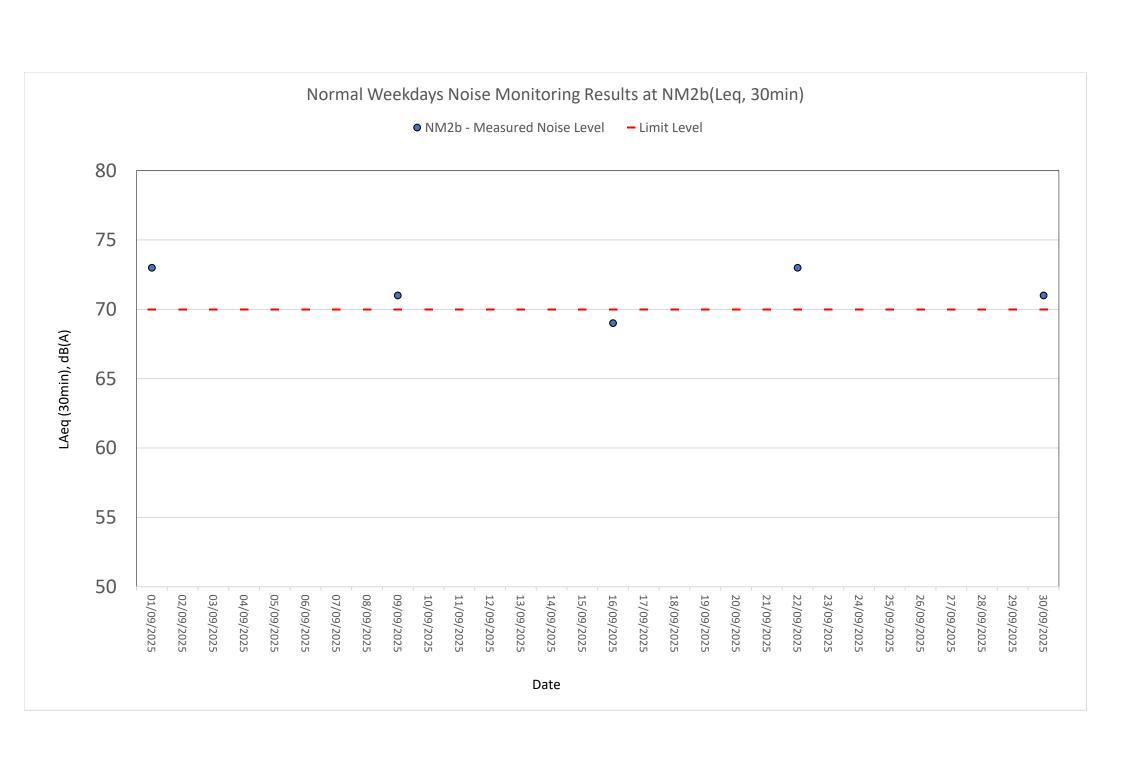

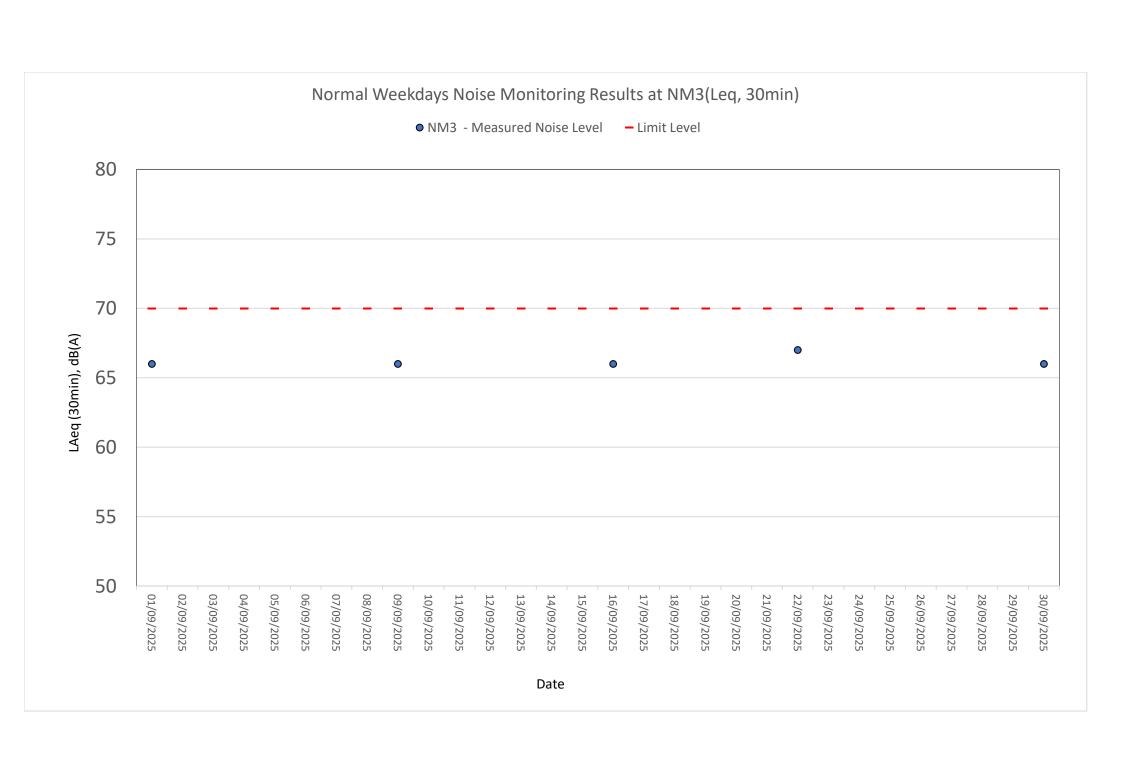

Appendix 8

Waste Flow Table

			Tot	tal Quantities o	of C&D Mater	ials to be G	enerated fr	om the Contract			
Month	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in Other Projects	Disposed as Public Fill (Inert waste) ¹	Imported Fill	Metals	Timber	Paper / Cardboard Packaging	Plastics	Chemical Waste	Others, e.g. general refuse (Non- inert waste) ²
Month	(in tonne)	(in tonne)	(in tonne)	(in tonne)	(in tonne)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000L)	(in tonne)
Jul-21	0	0	0	0	0	0	0	0	0	0	0
Aug-21	0	0	0	0	0	0	0	0	0	0	0
Sep-21	0	0	0	0	0	0	0	0	0	0	1.28
Oct-21	0	0	0	0	0	0	0	0	0	0	7.67
Nov-21	0	0	0	0	0	0	6.77	0.055	0	0	1.23
Dec-21	0	0	0	811.54	0	0	0	0	0	0	7.84
Jan-22	0	0	0	3270.80	0	0	0	0	0	0	2.50
Feb-22	0	0	0	2886.66	0	0	0	0	0	0	1.31
Mar-22	0	0	0	3793.00	0	0	0	0	0	0	3.43
Apr-22	0	0	0	3126.84	0	7.420	0	0	0	0	3.58
May-22	0	0	0	2414.91	0	0	0	0	0	0	3.64
Jun-22	0	0	0	4427.27	0	0	0	0	0	0	2.36
Jul-22	0	0	0	6759.07	0	0	0	0	0	1	4.28

			Tot	al Quantities o	of C&D Mater	ials to be G	enerated fr	om the Contract			
Month	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in Other Projects	Disposed as Public Fill (Inert waste) ¹	Imported Fill	Metals	Timber	Paper / Cardboard Packaging	Plastics	Chemical Waste	Others, e.g. general refuse (Non- inert waste) ²
WIOTILIT	(in tonne)	(in tonne)	(in tonne)	(in tonne)	(in tonne)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000L)	(in tonne)
Aug-22	0	0	0	5152.13	0	0	0	0	0	0	1.89
Sep-22	0	0	0	5305.27	0	0	0	0	0	0	8.32
Oct-22	0	0	0	5120.34	0	0	0	0	0	0	12.84
Nov-22	0	0	0	5733.35	0	0	0	0	0	0	1.75
Dec-22	0	0	0	2063.77	0	0	0	0	0	0	3.02
Jan-23	0	0	0	577.99	0	0	0	0	0	0	17.84
Feb-23	0	0	0	1493.86	0	0	0	0	0	0	45.42
Mar-23	0	0	0	3537.78	0	0	0	0	0	0	9.53
Apr-23	0	0	0	7255.41	0	0	0	0	0	0	7.86
May-23	0	0	0	1788.17	0	0	0	0	0	0	8.70
Jun-23	0	0	0	2005.44	0	0	0	0	0	0	27.29
Jul-23	0	0	0	2950.43	0	0	0	0	0	0.2	19.94
Aug-23	0	0	0	5610.19	0	0	0	0	0	0	26.12
Sep-23	0	0	0	1014.45	0	0	0	0	0	0	26.60
Oct-23	0	0	0	2479.82	0	0	0	0	0	0	31.78

			Tot	al Quantities o	of C&D Mater	ials to be G	enerated fr	om the Contract			
Month	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in Other Projects	Disposed as Public Fill (Inert waste) ¹	Imported Fill	Metals	Timber	Paper / Cardboard Packaging	Plastics	Chemical Waste	Others, e.g. general refuse (Non- inert waste) ²
WOILLI	(in tonne)	(in tonne)	(in tonne)	(in tonne)	(in tonne)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000L)	(in tonne)
Nov-23	0	0	0	2974.54	0	0	0	0	0	0	135.19
Dec-23	0	0	0	3126.35	0	0	0	0	0	0	59.96
Jan-24	0	0	0	1496.21	0	0	0	0	0	0	54.34
Feb-24	0	0	0	0	0	0	0	0	0	0	37.92
Mar-24	0	0	0	29.22	0	0	0	0	0	0	84.15
Apr-24	0	0	0	119.11	0	0	0	0	0	0	158.50
May-24	0	0	0	47.18	0	0	0	0	0	0	102.39
Jun-24	0	0	0	61.20	0	0	0	0	0	0	172.39
Jul-24	0	0	0	6.69	0	0	0	0	0	0	321.12
Aug-24	0	0	0	228.59	0	0	0	0	0	0	385.93
Sep-24	0	0	0	26.89	0	0	0	0	0	0	376.04
Oct-24	0	0	0	20.10	0	0	0	0	0	0	526.06
Nov-24	0	0	0	652.24	0	0	0	0	0	0	390.35
Dec-24	0	0	0	477.17	0	0	0	0	0	0	274.31
Jan-25	0	0	0	160.32	0	0	0	0	0	0	371.83

			Tot	al Quantities o	of C&D Mater	ials to be G	enerated fr	om the Contract			
Month	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in Other Projects	Disposed as Public Fill (Inert waste) ¹	Imported Fill	Metals	Timber	Paper / Cardboard Packaging	Plastics	Chemical Waste	Others, e.g. general refuse (Non- inert waste) ²
WORLT	(in tonne)	(in tonne)	(in tonne)	(in tonne)	(in tonne)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000L)	(in tonne)
Feb-25	0	0	0	65.82	0	0	0	0	0	0	419.38
Mar-25	0	0	0	203.67	0	0	0	0	0	0	545.90
Apr-25	0	0	0	395.72	0	0	0	0	0	0	498.88
May-25	0	0	0	284.46	0	0	0	0	0	0	442.45
Jun-25	0	0	0	18.97	0	0	0	0	0	0	532.52
Jul-25	0	0	0	169.53	0	0	0	0	0	0	278.73
Aug-25	0	0	0	113.11	0	0	0	0	0	0	231.70
Sep-25	0	0	0	15.72	0	0	0	0	0	0	265.81
Total	0	0	0	90271.30	0	7.420	6.77	0.055	0	1.2	6953.87

Note: 1. Inert waste will be disposed to Chai Wan Public Fill Barging Point (CW-PFBP) or Fill Bank at Tseung Kwan O Area 137(TKO137FB).

2. Non-inert waste (General refuse) will be disposed to North East New Territories Landfill (NENT).

Appendix 9

Environmental Site Inspection Checklist (Rev. 1)

Inspection Date:	04 September 2025	Inspected By:	Natalie Wong
Time:	15:00 – 15:45	Weather Condition:	Sunny
Participants:	Mr. L.K.Chiu (CE/COW's Represen	tative); Eric Leung (Con	tractor); Natalie Wong (ET)

Α	Permits/Licenses	N/A or Not Observed	Yes	No	Remarks / Photo
A1	Are Environmental Permit, license/ other permit displayed at major site exit and vehicle access?		\boxtimes		EP No.: EP-505/2015/A
A2	Are Construction Noise Permits available for inspection/posted at site entrance.		\boxtimes		
A3	Is wastewater discharge licence available for inspection?		\boxtimes		
A4	Are trip tickets for chemical waste and construction waste disposal available for inspection?		\boxtimes		
A5	Are relevant licence/permit for disposal of construction waste or excavated materials available for inspection?		\boxtimes		
В	Air Quality	N/A or Not Observed	Yes	No	Remarks / Photo
B1	Is open burning avoided?		\boxtimes		
B2	Are completed earthworks sealed as soon as practicable?		\boxtimes		
В3	Are plant and equipment well maintained (i. e. without black smoke from powered plant)?		\boxtimes		
B4	Are NRMM labels properly affixed on the PMEs?		\boxtimes		
B5	Any remedial action undertaken?	\boxtimes			N.A.
B6 Observed dust source(s)					
		⊠ Wind eros	ion		
		☑ Vehicle/ Equipment Movements			
		Loading/ unloading of materials			
		Others:			
B7	Are unpaved areas/ designated roads watered regularly to avoid dust generation?		\boxtimes		
B8	Are dusty materials covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the excavation or unloading?			\boxtimes	Observation 1
В9	After removal of stockpile, are the remained dusty materials wetted with water and cleared from surface of roads?		\boxtimes		
B10	Is the stockpile of dusty materials avoid to be extend beyond the pedestrian barriers, fencing or traffic cones?		\boxtimes		
B11	Are loaded dump trucks covered by impervious sheeting appropriately before leaving the site?	\boxtimes			N.A.

Environmental Site Inspection Checklist (Rev. 1)

B12	Are wheel washing facilities with high pressure water jet provided at all site exits if practicable?		\boxtimes		
B13	Are all vehicles and plant cleaned before they leave		\boxtimes		
B14	the construction site? Are hoarding ≥ 2.4m tall provided beside roads or				
D14	area with public access?		\boxtimes		
B15	Is the portion of any road leading only to				
	construction site (within 30m of a vehicle entrance		\boxtimes		
	or exit) kept clear of dusty materials?				
B16	Are surfaces where any pneumatic or power-driven		\boxtimes		
	drilling, cutting, polishing or other mechanical				
	breaking operations takes place sprayed with water				
	or a dust suppression chemical continuously?				
B17	Is the area involved demolition activities sprayed	\boxtimes			
	with water or a dust suppression chemical				
	immediately prior to, during and immediately after				N.A.
	the activities so as to maintain the entire surface wet?				
B18	Is scaffolding erected around the perimeter of a		<u> </u>		
БТО	building under construction?		\boxtimes		
B19	Are effective dust screens, sheeting or netting		\boxtimes		
	provided to enclose the scaffolding from the ground				
	floor level of the building, or a canopy provided from				
	the first floor level up to the highest level of the				
	scaffolding?				
B20	Is the skip hoist for materials transport enclosed by	\boxtimes			N.A.
	impervious sheeting?	_			
B21	Is every stock of more than 20 bags of cement or		\boxtimes		
	dry pulverized fuel ash (PFA) covered entirely by				
	impervious sheeting or placed in an area sheltered on the top and 3 sides?				
B22	Are the areas of washing facilities and the road				
DZZ	section between the washing facilities and the exit		\boxtimes	Ш	
	point paved with concrete, bituminous materials or				
	hardcores?				
B23	Are cement or dry PFA delivered in bulk stored in a		\boxtimes		
	closed silo fitted with an audible high-level alarm			Ш	
	which is interlocked with the material filling line and				
	no overfilling is allowed?				
B24	Are the activities of loading, unloading, transfer,		\boxtimes		
	handing or storage of bulk cement or dry PFA				
DOF	carried out in a totally enclosed system or facility?				
B25	Is any vent or exhaust fitted with an effective fabric filter or equipment air pollution control system?	\boxtimes			N.A.
B26	Is the exposed earth properly treated by				
D20	compaction, turfing, hydroseeding, vegetation		\boxtimes		
	planting or sealing with latex, vinyl, bitumen,				
	shotcrete or other suitable surface stabiliser within				
	six months after last construction activity on the				
	construction site or part of the construction site				
	where the exposed earth lies?				
B27	Are the worksites wetted with water regularly?		\boxtimes		
B28	Is generation of dust avoided during loading or				
	unloading?		\boxtimes		
B29	Are all trucks loaded to a level within the side and tail boards?		\boxtimes		
		1	1		<u> </u>

Contract No. SS H504 Design and Construction of Chai Wan Government Complex and Vehicle Depot

Report No. _0196-20250904

Depot Environmental Site Inspection Checklist (Rev. 1)

C1 Is well-maintained plant operated on-site and plant	emarks / Photo				
roads? C Noise N/A or Not Observed Observed Is well-maintained plant operated on-site and plant	emarks / Photo				
C1 Is well-maintained plant operated on-site and plant	emarks / Photo				
C1 Is well-maintained plant operated on-site and plant	emarks / Photo				
served regularly?					
C2 Are vehicles and equipment switched off or throttled down while not in use?					
C3 Is the noise directed away from nearby NSRs?					
C4 Are the silencers or mufflers properly fitted on construction equipment and maintained regularly?					
Are mobile and/or noisy plant sited as far away from NSRs as possible and practicable and orientated so that the noise is directed away from nearby NSRs?					
C6 Are material stockpiles, mobile container officer and other structures utilised to screen noisy activates?	N.A.				
Is temporary hoarding installed located on the site boundaries between noisy construction activities and NSRs?					
Are noise barriers (typically density @14kg/m²) acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs?					
C9 Is the sequencing operation of construction plants where practicable?					
C10 Is the hoarding maintained properly?					
C11 Do air compressors have valid noise labels?					
C12 Are compressor operated with doors closed?					
C13 QPME used with valid noise labels?					
C14 Major noise source(s)					
☐ Traffic					
Construction activities inside of site	Construction activities inside of site				
Construction activities outside of site	Construction activities outside of site				
Others:					

D	Water Quality	N/A or Not Observed	Yes	No	Remarks / Photo
Const	ruction Activities				
D1	Are catchpits and perimeter channels constructed in advance of site formation works and earthworks?		\boxtimes		
D2	Is wastewater from temporary site facilities controlled to prevent direct discharge to surface or marine water?		\boxtimes		
D3	Is minimise surface excavation works during rainy seasons (April to September), as possible?		\boxtimes		
D4	Is the storm drainage directed to storm drains via adequately designed sand/ silt removal facilities e.g. sand traps, silt?		\boxtimes		
D5	Are channels, earth bunds or sandbag barriers provided on site to properly direct stormwater to such silt removal facilities?		\boxtimes		
D6	Are the silt removal facilities, channels and manholes maintained regularly?		\boxtimes		
D7	Are the temporary access roads surfaced with crushed stone or gravel?		\boxtimes		
D8	Is the deposited silt and grit removed regularly?		\boxtimes		
D9	Is rainwater pumped out from trenches discharged into storm drains via silt system?		\boxtimes		
D10	Are measures taken to prevent the washout of construction materials, soil, silt or debris into any drainage system?		\boxtimes		
D11	Are open stockpiles of construction materials e.g. aggregates and sand on site covered with tarpaulin or similar fabric during rainstorms?		\boxtimes		
D12	Are manholes adequately covered and temporarily sealed so as to prevent silt, construction materials or debris from getting into the drainage?		\boxtimes		
D13	Are the discharges of surface run-off into foul sewer always prevented?		\boxtimes		
D14	Is a wheel washing bay provided at every site exit?		\boxtimes		
D15	Is the wheel wash overflow directed to silt removal facilities before being discharged to the storm drain?		\boxtimes		
D16	Is the section of construction road between the wheel washing bay and the public road surfaced with crushed stone or coarse gravel?		\boxtimes		
D17	Is wastewater generated from concreting, plastering, internal decoration, cleaning work and other similar activities screened to remove large objects?		\boxtimes		
D18	Are the vehicle and plant serving areas, vehicle wash bays and lubrication facilities located under roofed areas?		\boxtimes		
D19	Is leakage or spillages contained and cleaned up immediately?		\boxtimes		
D20	Does the surface runoff from bunded areas pass through oil/grease traps prior to discharge to the storm water system?	\boxtimes			N.A.

Environmental Site Inspection Checklist (Rev. 1)

D21	Are site drainage systems provided over the entire project site with sediment control facilities?		\boxtimes		
D22	Are sedimentation tanks or package treatment systems provided to treat the large amount of sediment-laden wastewater generated from wheel washing, site runoff and construction works?		\boxtimes		
D23	Is the generated wastewater with high concentrations of SS collected to the sedimentation tanks or package treatment systems for proper treatment prior to disposal?		\boxtimes		
D24	Is the treated wastewater reused for vehicle washing, dust suppression and general cleaning?		\boxtimes		
D25	Is the sewage generated from toilets collected using a temporary storage system?		\boxtimes		
D26	Is there any sediment plume observed in nearby watercourses?			\boxtimes	
D27	Are slit-grease traps deployed to prevent a direct input of road surface runoff to the marine waters?	\boxtimes			N.A.
E	Waste / Chemical Management	N/A or Not Observed	Yes	No	Remarks / Photo
Genera	al Waste				
E1	Is the general waste generated on-site stored in enclosed bins or compaction units separately from the construction and chemical wastes?		\boxtimes		
E2	Is the general waste collected properly by using the waste separation facilities for paper, aluminium cans, plastic bottles etc.?		\boxtimes		
E3	Does accumulation of waste avoid?		\boxtimes		
E4	Is waste disposed regularly?		\boxtimes		
Constr	uction Waste				
E5	Are the temporary stockpiles maintained regularly?		\boxtimes		
E6	Is the excavated fill material reused for backfilling and reinstatement?		\boxtimes		
E7	Are the C&D materials sorted and recycled on-				
	site?		\boxtimes		
E8	•				Not Observed
E8	site? Is there any contract documents provided to allow and promote the use of recycled aggregates where appropriate? Is the disposal of C&D materials avoided onto any sensitive locations e.g. agricultural lands etc.?				Not Observed N.A.
E9 E10	site? Is there any contract documents provided to allow and promote the use of recycled aggregates where appropriate? Is the disposal of C&D materials avoided onto any sensitive locations e.g. agricultural lands etc.? Are the public fill and C&D waste segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal?				
E9	site? Is there any contract documents provided to allow and promote the use of recycled aggregates where appropriate? Is the disposal of C&D materials avoided onto any sensitive locations e.g. agricultural lands etc.? Are the public fill and C&D waste segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper				
E9 E10	site? Is there any contract documents provided to allow and promote the use of recycled aggregates where appropriate? Is the disposal of C&D materials avoided onto any sensitive locations e.g. agricultural lands etc.? Are the public fill and C&D waste segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal? Is the durable formwork or plastic facing for				N.A.

Contract No. SS H504 Design and Construction of

Chai Wan Government Complex and Vehicle Depot

Environmental Site Inspection Checklist (Rev. 1)

Report No. _0196-20250904

E14	Is the segregation and storage of C&D wastes undertaken in designated area?		\boxtimes			
E15	Are waste storage area properly cleaned and do not cause windblown litter and dust nuisance?		\boxtimes			
E16	Do the excavated materials appear contaminated?		\boxtimes			
E17	If suspected contaminated, appropriate procedures followed?	\boxtimes			N.A.	
Chemi	cal / Fuel Storage Area					
E18	Are the fuel tanks and chemical storage areas provided with locks and sited on sealed areas?		\boxtimes			
E19	Are the storage area enclosed 3 sides by walls/ fence of ≥2m tall and bounded with adequate bund capacity (>110% of largest container) or do the storage area allow storage of 20% of total volume of waste?		\boxtimes			
E20	Are the storage areas labelled and separated (if needed)?		\boxtimes			
E21	Do the storage areas have adequate ventilation and be covered to prevent rainfall entering?		\boxtimes			
E22	Are the containers used for the storage of chemical wastes suitable for the substance that are holding, resist to corrosion, maintained in a good condition, and securely closed?		\boxtimes			
E23	If no specification has been approved by EPD, are container with <450L capacity provided for storage of chemicals waste?		\boxtimes			
Chemi	cal Waste / Waste Oil					
E24	Is chemical waste or waste oil stored and labelled in English and Chinese properly in designated area?		\boxtimes			
E25	Are chemicals and waste oil recycled or disposed properly?		\boxtimes			
E26	Is waste oil collected and stored for recycling or disposal?		\boxtimes			
Records						
E27	Is a licensed waste haulier used for waste collection?		\boxtimes			
E28	Are the records of quantities of wastes generated, recycled, and disposed properly kept?		\boxtimes			
E29	For the demolition material/ waste, is the number of loads for each day recorded as appropriate?	\boxtimes			N.A.	

F	Landscape and Visual Impacts N/		Yes	No	Remarks / Photo
F1	Is the work site confined within site boundaries?		\boxtimes		
F2	Is damage to surrounding areas avoided?		\boxtimes		
F3	Is the hoardings with aesthetic treatment provided and designed to be subtle and camouflaged?		\boxtimes		
F4	Is the temporary landscape treatment provided (such as the provision of temporary landscape planting around the Site office in ornamental pots and application of green roof for Site office)?		\boxtimes		
F5	Are the protective fencing erected along or beyond the perimeter of the tree protection zone of each individual tree?	\boxtimes			To be implemented before demolition of hoarding
G	Environmental Complaint	N/A or Not Observed	Yes	No	Remarks / Photo
G1	Number of Environmental Complaint received between inspection weeks.			\boxtimes	
					<u> </u>
Н	General Housekeeping	N/A or Not Observed	Yes	No	Remarks / Photo
H1	Are potential stagnant pools cleared and mosquito breeding prevented?		\boxtimes		
H2	Are the defined boundaries of working areas identified to prevent loss of vegetation		\boxtimes		
I	Others	N/A or Not Observed	Yes	No	Remarks / Photo
I1	Are the portable toilets maintained in a state, which will not deter the workers from utilizing these portable toilets?		\boxtimes		

Chai Wan Government Complex and Vehicle Depot

Follow up action for previous Site Inspection:

28 August 2025 Observation

1. The NRMM label has been displayed conspicuously on the PME. (Photo R1)



Photo R1

Observation(s):

1. Opened cement bags were observed on the rooftop. (Photo O1 & O2)

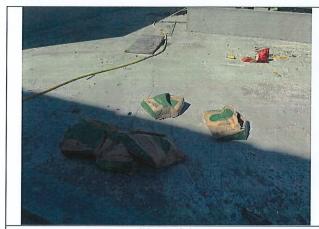






Photo O2

Corrective Actions – Mitigation Measures Implemented or Proposed (if any):

1. The Contractor is recommended to cover the opened cement bags when they are not in use. For the cement bags that are no longer in use, they should be collected and removed properly.

	Environmental Team Representative:	IEC's Representative:	Contractor's Representative:	CE/COW's Representative
Signature:	Notalie	/		17,
Name:	Natalie Wong	1	Desmond Ho	LK CH 14
Date:	04 September 2025	1	10 September 2025	10 September 2025

Inspe	ction Date:	10 September 2025	Inspected By:	d By: Natalie Wong			atalie Wong	
Time:		14:15 – 15:00	Weather Conditi	ather Condition: Sunny				
Partic	ipants:	Mr. C.K.Sin (Engineer's Representa (ET)	itive); Eric Leung	(Con	tractor);	Byron S	uen (IEC); Natalie Wong	
Α	Permits/Lic	enses	N/A or No Observed		Yes	No	Remarks / Photo	
A1	displayed at	mental Permit, license/ other permit major site exit and vehicle access?			\boxtimes		EP No.: EP-505/2015/A	
A2	inspection/p	ction Noise Permits available for osted at site entrance.			\boxtimes			
A3	inspection?	er discharge licence available for			\boxtimes			
A4		ets for chemical waste and constructio sal available for inspection?	n 🗆		\boxtimes			
A5	Are relevant construction for inspection	ole 🗌		\boxtimes				
В	Air Quality		N/A or No Observed		Yes	No	Remarks / Photo	
B1	Is open burr	ning avoided?			\boxtimes			
B2	Are complet practicable?	ed earthworks sealed as soon as			\boxtimes			
В3		d equipment well maintained (i. e. k smoke from powered plant)?			\boxtimes			
B4	Are NRMM	labels properly affixed on the PMEs?			\boxtimes			
B5	Any remedia	al action undertaken?	\boxtimes				N.A.	
В6	Observed d	ust source(s)						
			⊠ Wind e	rosion	1			
			⊠ Vehicle	□ Vehicle/ Equipment Movements				
			☐ Loadin	☐ Loading/ unloading of materials				
			Others:	Others:				
B7	-	d areas/ designated roads watered avoid dust generation?			\boxtimes			
B8	Are dusty m sheeting or entire surface reinstated w excavation of	aterials covered entirely by imperviou sprayed with water to maintain the ce wet and then removed or backfilled where practicable within 24 hours of the or unloading? al of stockpile, are the remained dusty	or e					

materials wetted with water and cleared from

Is the stockpile of dusty materials avoid to be

extend beyond the pedestrian barriers, fencing or

surface of roads?

traffic cones?

B10

 \boxtimes

 \boxtimes

B11	Are loaded dump trucks covered by impervious sheeting appropriately before leaving the site?	\boxtimes			N.A.
B12	Are wheel washing facilities with high pressure water jet provided at all site exits if practicable?		\boxtimes		
B13	Are all vehicles and plant cleaned before they leave the construction site?		\boxtimes		
B14	Are hoarding ≥ 2.4m tall provided beside roads or		\boxtimes		
D45	area with public access?				
B15	Is the portion of any road leading only to construction site (within 30m of a vehicle entrance or exit) kept clear of dusty materials?				
B16	Are surfaces where any pneumatic or power-driven		\boxtimes		
	drilling, cutting, polishing or other mechanical				
	breaking operations takes place sprayed with water				
5.47	or a dust suppression chemical continuously?				
B17	Is the area involved demolition activities sprayed	\boxtimes			
	with water or a dust suppression chemical immediately prior to, during and immediately after				N.A.
	the activities so as to maintain the entire surface				IN.A.
	wet?				
B18	Is scaffolding erected around the perimeter of a				
	building under construction?		\boxtimes		
B19	Are effective dust screens, sheeting or netting		\boxtimes		
	provided to enclose the scaffolding from the ground				
	floor level of the building, or a canopy provided from				
	the first floor level up to the highest level of the				
	scaffolding?				
B20	Is the skip hoist for materials transport enclosed by	\boxtimes			N.A.
B21	impervious sheeting? Is every stock of more than 20 bags of cement or		<u> </u>		
021	dry pulverized fuel ash (PFA) covered entirely by		\boxtimes		
	impervious sheeting or placed in an area sheltered				
	on the top and 3 sides?				
B22	Are the areas of washing facilities and the road		\boxtimes		
	section between the washing facilities and the exit				
	point paved with concrete, bituminous materials or				
DOO	hardcores?				
B23	Are cement or dry PFA delivered in bulk stored in a closed silo fitted with an audible high-level alarm		\boxtimes		
	which is interlocked with the material filling line and				
	no overfilling is allowed?				
B24	Are the activities of loading, unloading, transfer,		\boxtimes		
	handing or storage of bulk cement or dry PFA			Ш	
	carried out in a totally enclosed system or facility?				
B25	Is any vent or exhaust fitted with an effective fabric	\boxtimes			N.A.
	filter or equipment air pollution control system?				14.7 %
B26	Is the exposed earth properly treated by		\boxtimes		
	compaction, turfing, hydroseeding, vegetation				
	planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabiliser within				
	six months after last construction activity on the				
	construction site or part of the construction site				
	where the exposed earth lies?				
B27	Are the worksites wetted with water regularly?		\boxtimes		
B28	Is generation of dust avoided during loading or				
	unloading?		\boxtimes		

Contract No. SS H504 Design and Construction of

Chai Wan Government Complex and Vehicle Depot

Environmental Site Inspection Checklist (Rev. 1)

Report No. _0197-20250910

B29	Are all trucks loaded to a level within the side and		\boxtimes			
B30	tail boards? Are appropriate speed limit sign displayed?		\boxtimes			
B31	Are designated roads paved?		\boxtimes			
B32	Are site vehicle movements confined to designated roads?		\boxtimes			
				<u> </u>		
С	Noise	N/A or Not Observed	Yes	No	Remarks / Photo	
C1	Is well-maintained plant operated on-site and plant served regularly?		\boxtimes			
C2	Are vehicles and equipment switched off or throttled down while not in use?		\boxtimes			
C3	Is the noise directed away from nearby NSRs?		\boxtimes			
C4	Are the silencers or mufflers properly fitted on construction equipment and maintained regularly?		\boxtimes			
C5	Are mobile and/or noisy plant sited as far away from NSRs as possible and practicable and orientated so that the noise is directed away from nearby NSRs?		\boxtimes			
C6	Are material stockpiles, mobile container officer and other structures utilised to screen noisy activates?	\boxtimes			N.A.	
C7	Is temporary hoarding installed located on the site boundaries between noisy construction activities and NSRs?		\boxtimes			
C8	Are noise barriers (typically density @14kg/m²) acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs?		\boxtimes			
C9	Is the sequencing operation of construction plants where practicable?		\boxtimes			
C10	Is the hoarding maintained properly?		\boxtimes			
C11	Do air compressors have valid noise labels?		\boxtimes			
C12	Are compressor operated with doors closed?		\boxtimes			
C13	QPME used with valid noise labels?		\boxtimes			
C14	Major noise source(s)					
		☐ Traffic				
		⊠ Construct	ion activiti	es inside	of site	
		Construction activities outside of site				
		Others:				

D	Water Quality	N/A or Not Observed	Yes	No	Remarks / Photo
Constr	ruction Activities				
D1	Are catchpits and perimeter channels constructed in advance of site formation works and earthworks?		\boxtimes		
D2	Is wastewater from temporary site facilities controlled to prevent direct discharge to surface or marine water?		\boxtimes		
D3	Is minimise surface excavation works during rainy seasons (April to September), as possible?		\boxtimes		
D4	Is the storm drainage directed to storm drains via adequately designed sand/ silt removal facilities e.g. sand traps, silt?		\boxtimes		
D5	Are channels, earth bunds or sandbag barriers provided on site to properly direct stormwater to such silt removal facilities?		\boxtimes		
D6	Are the silt removal facilities, channels and manholes maintained regularly?		\boxtimes		
D7	Are the temporary access roads surfaced with crushed stone or gravel?		\boxtimes		
D8	Is the deposited silt and grit removed regularly?		\boxtimes		
D9	Is rainwater pumped out from trenches discharged into storm drains via silt system?		\boxtimes		
D10	Are measures taken to prevent the washout of construction materials, soil, silt or debris into any drainage system?			\boxtimes	Observation 1
D11	Are open stockpiles of construction materials e.g. aggregates and sand on site covered with tarpaulin or similar fabric during rainstorms?		\boxtimes		
D12	Are manholes adequately covered and temporarily sealed so as to prevent silt, construction materials or debris from getting into the drainage?		\boxtimes		
D13	Are the discharges of surface run-off into foul sewer always prevented?		\boxtimes		
D14	Is a wheel washing bay provided at every site exit?		\boxtimes		
D15	Is the wheel wash overflow directed to silt removal facilities before being discharged to the storm drain?		\boxtimes		
D16	Is the section of construction road between the wheel washing bay and the public road surfaced with crushed stone or coarse gravel?		\boxtimes		
D17	Is wastewater generated from concreting, plastering, internal decoration, cleaning work and other similar activities screened to remove large objects?		\boxtimes		
D18	Are the vehicle and plant serving areas, vehicle wash bays and lubrication facilities located under roofed areas?		\boxtimes		
D19	Is leakage or spillages contained and cleaned up immediately?		\boxtimes		
D20	Does the surface runoff from bunded areas pass through oil/grease traps prior to discharge to the storm water system?	\boxtimes			N.A.

st (Rev. 1)

Chai Wan Government Complex and Vehicle Depot	Environmental Site Inspection Checklis

D21	Are site drainage systems provided over the entire project site with sediment control facilities?		\boxtimes		
	Are sedimentation tanks or package treatment				
	systems provided to treat the large amount of		<u> </u>		
D22	sediment-laden wastewater generated from wheel		\boxtimes		
	washing, site runoff and construction works?				
	Is the generated wastewater with high				
Doo	concentrations of SS collected to the				
D23	sedimentation tanks or package treatment systems		\boxtimes	Ш	
	for proper treatment prior to disposal?				
D24	Is the treated wastewater reused for vehicle		\boxtimes		
D24	washing, dust suppression and general cleaning?			Ш	
D25	Is the sewage generated from toilets collected		\boxtimes		
D23	using a temporary storage system?				
D26	Is there any sediment plume observed in nearby			\boxtimes	
D20	watercourses?				
D27	Are slit-grease traps deployed to prevent a direct	\boxtimes			N.A.
DZI	input of road surface runoff to the marine waters?				1437 G
_		N/A or Not			
E	Waste / Chemical Management	Observed	Yes	No	Remarks / Photo
Conor	al Waste				
Genera		1			
	Is the general waste generated on-site stored in		\boxtimes		
E1	enclosed bins or compaction units separately from				
	the construction and chemical wastes?				
F2	Is the general waste collected properly by using		\boxtimes		
E2	the waste separation facilities for paper, aluminium				
	cans, plastic bottles etc.?				
E3	Does accumulation of waste avoid?		\boxtimes		
E4	Is waste disposed regularly?		\boxtimes		
Constr	ruction Waste				
E5					
	Are the temporary stockpiles maintained regularly?		\boxtimes		
E6	Is the excavated fill material reused for backfilling		\boxtimes		
	and reinstatement?				
E7	Are the C&D materials sorted and recycled on-		\boxtimes		
	site?				
E8	Is there any contract documents provided to allow and promote the use of recycled aggregates where	\boxtimes			Not Observed
	appropriate?				Not Observed
E9					
LJ	Is the disposal of C&D materials avoided onto any sensitive locations e.g. agricultural lands etc.?	\boxtimes	Ш	Ш	N.A.
E10	Are the public fill and C&D waste segregated and		\boxtimes		
	stored in different containers or skips to enhance				
	reuse or recycling of materials and their proper				
	disposal?				
E11	Is the durable formwork or plastic facing for	\boxtimes			N.A.
	construction works used?]	13.73.
E12	Do the wooden hoardings avoid to be used?		\boxtimes		
E13	Is metal hoarding used to enhance the possibility	\boxtimes			
	of recycling?				

Contract No. SS H504 Design and Construction of

Report No. _0197-20250910
Environmental Site Inspection Checklist (Rev. 1)

Chai Wan Government Complex and Vehicle Depot

E14	Is the segregation and storage of C&D wastes undertaken in designated area?		\boxtimes		
E15	Are waste storage area properly cleaned and do not cause windblown litter and dust nuisance?		\boxtimes		
E16	Do the excavated materials appear contaminated?		\boxtimes		
E17	If suspected contaminated, appropriate procedures followed?	\boxtimes			N.A.
Chemi	cal / Fuel Storage Area				
E18	Are the fuel tanks and chemical storage areas provided with locks and sited on sealed areas?		\boxtimes		
E19	Are the storage area enclosed 3 sides by walls/ fence of ≥2m tall and bounded with adequate bund capacity (>110% of largest container) or do the storage area allow storage of 20% of total volume of waste?				
E20	Are the storage areas labelled and separated (if needed)?		\boxtimes		
E21	Do the storage areas have adequate ventilation and be covered to prevent rainfall entering?		\boxtimes		
E22	Are the containers used for the storage of chemical wastes suitable for the substance that are holding, resist to corrosion, maintained in a good condition, and securely closed?		\boxtimes		
E23	If no specification has been approved by EPD, are container with <450L capacity provided for storage of chemicals waste?		\boxtimes		
Chemi	cal Waste / Waste Oil				
E24	Is chemical waste or waste oil stored and labelled in English and Chinese properly in designated area?		\boxtimes		
E25	Are chemicals and waste oil recycled or disposed properly?		\boxtimes		
E26	Is waste oil collected and stored for recycling or disposal?		\boxtimes		
Records					
E27	Is a licensed waste haulier used for waste collection?		\boxtimes		
E28	Are the records of quantities of wastes generated, recycled, and disposed properly kept?		\boxtimes		
E29	For the demolition material/ waste, is the number of loads for each day recorded as appropriate?	\boxtimes			N.A.

F	Landscape and Visual Impacts	N/A or Not Observed	Yes	No	Remarks / Photo
F1	Is the work site confined within site boundaries?		\boxtimes		
F2	Is damage to surrounding areas avoided?		\boxtimes		
F3	Is the hoardings with aesthetic treatment provided and designed to be subtle and camouflaged?		\boxtimes		
F4	Is the temporary landscape treatment provided (such as the provision of temporary landscape planting around the Site office in ornamental pots and application of green roof for Site office)?		\boxtimes		
F5	Are the protective fencing erected along or beyond the perimeter of the tree protection zone of each individual tree?	\boxtimes			To be implemented before demolition of hoarding
G	Environmental Complaint	N/A or Not Observed	Yes	No	Remarks / Photo
G1	Number of Environmental Complaint received between inspection weeks.			\boxtimes	
Н	General Housekeeping	N/A or Not Observed	Yes	No	Remarks / Photo
H1	Are potential stagnant pools cleared and mosquito breeding prevented?		\boxtimes		
H2	Are the defined boundaries of working areas identified to prevent loss of vegetation		\boxtimes		
I	Others	N/A or Not Observed	Yes	No	Remarks / Photo
I1	Are the portable toilets maintained in a state, which will not deter the workers from utilizing these portable toilets?		\boxtimes		

Follow up action for previous Site Inspection:

04 September 2025 Observation

1. The opened cement bags on the rooftop were removed properly. (Photo R1 & R2)







Photo R2

Observation(s):

 General waste was observed near the drainage system on the rooftop. (Photo O1)

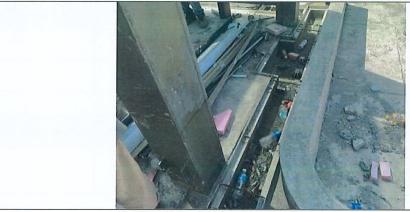


Photo O1

<u>Corrective Actions – Mitigation Measures Implemented or Proposed (if any):</u>

1. The Contractor is recommended to remove the general waste from the drainage system.

	Environmental Team Representative:	IEC's Representative:	Contractor's Representative:	CE/COW's Representative
Signature:	Notalie	Byronds	7.	No.
Name:	Natalie Wong	Byron Suen	Desmond Ho	LK CHIY
Date:	10 September 2025	10 September 2025	10 September 2025	10 September 2025

Inspection Date:	18 September 2025	Inspected By:	Natalie Wong			
Time:	15:00 – 15:45	Weather Condition:	Sunny			
Participants:	Mr. L.K.Chiu (CE/COW's Representative); Eric Leung (Contractor); Natalie Wong (ET)					

Α	Permits/Licenses	N/A or Not Observed	Yes	No	Remarks / Photo	
A1	Are Environmental Permit, license/ other permit displayed at major site exit and vehicle access?		\boxtimes		EP No.: EP-505/2015/A	
A2	Are Construction Noise Permits available for inspection/posted at site entrance.		\boxtimes			
A3	Is wastewater discharge licence available for inspection?		\boxtimes			
A4	Are trip tickets for chemical waste and construction waste disposal available for inspection?		\boxtimes			
A5	Are relevant licence/permit for disposal of construction waste or excavated materials available for inspection?		\boxtimes			
В	Air Quality	N/A or Not Observed	Yes	No	Remarks / Photo	
B1	Is open burning avoided?		\boxtimes			
B2	Are completed earthworks sealed as soon as practicable?		\boxtimes			
В3	Are plant and equipment well maintained (i. e. without black smoke from powered plant)?		\boxtimes			
B4	Are NRMM labels properly affixed on the PMEs?		\boxtimes			
B5	Any remedial action undertaken?	\boxtimes			N.A.	
В6	Observed dust source(s)					
		⊠ Wind eros	sion			
		⊠ Vehicle/ E	quipment	Movemer	nts	
		Loading/ unloading of materials				
		Others: _				
В7	Are unpaved areas/ designated roads watered regularly to avoid dust generation?		\boxtimes			
B8	Are dusty materials covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the		\boxtimes		Reminder 1	
	excavation or unloading?					
B9	After removal of stockpile, are the remained dusty materials wetted with water and cleared from surface of roads?		\boxtimes			
B10	Is the stockpile of dusty materials avoid to be extend beyond the pedestrian barriers, fencing or traffic cones?		\boxtimes			
B11	Are loaded dump trucks covered by impervious	\boxtimes			N.A.	

sheeting appropriately before leaving the site?

B12	Are wheel washing facilities with high pressure water jet provided at all site exits if practicable?		\boxtimes		
B13	Are all vehicles and plant cleaned before they leave the construction site?		\boxtimes		
B14	Are hoarding ≥ 2.4m tall provided beside roads or				
D	area with public access?	Ш	\boxtimes	Ш	
B15	Is the portion of any road leading only to	П	\boxtimes		
	construction site (within 30m of a vehicle entrance				
	or exit) kept clear of dusty materials?				
B16	Are surfaces where any pneumatic or power-driven		\boxtimes		
	drilling, cutting, polishing or other mechanical breaking operations takes place sprayed with water				
	or a dust suppression chemical continuously?				
B17	Is the area involved demolition activities sprayed				
D17	with water or a dust suppression chemical	\boxtimes			
	immediately prior to, during and immediately after				N.A.
	the activities so as to maintain the entire surface				
	wet?				
B18	Is scaffolding erected around the perimeter of a		\boxtimes		
	building under construction?				
B19	Are effective dust screens, sheeting or netting		\boxtimes		
	provided to enclose the scaffolding from the ground				
	floor level of the building, or a canopy provided from the first floor level up to the highest level of the				
	scaffolding?				
B20	Is the skip hoist for materials transport enclosed by	\square			
	impervious sheeting?	\boxtimes			N.A.
B21	Is every stock of more than 20 bags of cement or	П	\boxtimes		
	dry pulverized fuel ash (PFA) covered entirely by				
	impervious sheeting or placed in an area sheltered				
DOO	on the top and 3 sides?				
B22	Are the areas of washing facilities and the road section between the washing facilities and the exit		\boxtimes		
	point paved with concrete, bituminous materials or				
	hardcores?				
B23	Are cement or dry PFA delivered in bulk stored in a		\boxtimes		
	closed silo fitted with an audible high-level alarm				
	which is interlocked with the material filling line and				
	no overfilling is allowed?				
B24	Are the activities of loading, unloading, transfer,		\boxtimes		
	handing or storage of bulk cement or dry PFA carried out in a totally enclosed system or facility?				
B25	Is any vent or exhaust fitted with an effective fabric				
220	filter or equipment air pollution control system?				N.A.
B26	Is the exposed earth properly treated by		\boxtimes		
	compaction, turfing, hydroseeding, vegetation				
	planting or sealing with latex, vinyl, bitumen,				
	shotcrete or other suitable surface stabiliser within				
	six months after last construction activity on the				
	construction site or part of the construction site where the exposed earth lies?				
B27	Are the worksites wetted with water regularly?				
B28	Is generation of dust avoided during loading or unloading?		\boxtimes		
B29	Are all trucks loaded to a level within the side and tail boards?		\boxtimes		

Contract No. SS H504 Design and Construction of Chai Wan Government Complex and Vehicle Depot

Report No. _0198-20250918

B30	Are appropriate speed limit sign displayed?		\boxtimes			
B31	Are designated roads paved?		\boxtimes			
B32	Are site vehicle movements confined to designated roads?		\boxtimes			
С	Noise	N/A or Not Observed	Yes	No	Remarks / Photo	
C1	Is well-maintained plant operated on-site and plant served regularly?		\boxtimes			
C2	Are vehicles and equipment switched off or throttled down while not in use?		\boxtimes			
C3	Is the noise directed away from nearby NSRs?		\boxtimes			
C4	Are the silencers or mufflers properly fitted on construction equipment and maintained regularly?		\boxtimes			
C5	Are mobile and/or noisy plant sited as far away from NSRs as possible and practicable and orientated so that the noise is directed away from nearby NSRs?		\boxtimes			
C6	Are material stockpiles, mobile container officer and other structures utilised to screen noisy activates?	\boxtimes			N.A.	
C7	Is temporary hoarding installed located on the site boundaries between noisy construction activities and NSRs?		\boxtimes			
C8	Are noise barriers (typically density @14kg/m²) acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs?		\boxtimes			
C9	Is the sequencing operation of construction plants where practicable?		\boxtimes			
C10	Is the hoarding maintained properly?		\boxtimes			
C11	Do air compressors have valid noise labels?		\boxtimes			
C12	Are compressor operated with doors closed?		\boxtimes			
C13	QPME used with valid noise labels?		\boxtimes			
C14	Major noise source(s)					
		Traffic				
		Construction activities inside of site				
		Construction activities outside of site				
		Others:			_	

D	Water Quality	N/A or Not Observed	Yes	No	Remarks / Photo
Constr	ruction Activities				
D1	Are catchpits and perimeter channels constructed in advance of site formation works and earthworks?		\boxtimes		
D2	Is wastewater from temporary site facilities controlled to prevent direct discharge to surface or marine water?		\boxtimes		
D3	Is minimise surface excavation works during rainy seasons (April to September), as possible?		\boxtimes		
D4	Is the storm drainage directed to storm drains via adequately designed sand/ silt removal facilities e.g. sand traps, silt?		\boxtimes		
D5	Are channels, earth bunds or sandbag barriers provided on site to properly direct stormwater to such silt removal facilities?		\boxtimes		
D6	Are the silt removal facilities, channels and manholes maintained regularly?		\boxtimes		
D7	Are the temporary access roads surfaced with crushed stone or gravel?		\boxtimes		
D8	Is the deposited silt and grit removed regularly?		\boxtimes		
D9	Is rainwater pumped out from trenches discharged into storm drains via silt system?		\boxtimes		
D10	Are measures taken to prevent the washout of construction materials, soil, silt or debris into any drainage system?		\boxtimes		
D11	Are open stockpiles of construction materials e.g. aggregates and sand on site covered with tarpaulin or similar fabric during rainstorms?		\boxtimes		
D12	Are manholes adequately covered and temporarily sealed so as to prevent silt, construction materials or debris from getting into the drainage?		\boxtimes		
D13	Are the discharges of surface run-off into foul sewer always prevented?		\boxtimes		
D14	Is a wheel washing bay provided at every site exit?		\boxtimes		
D15	Is the wheel wash overflow directed to silt removal facilities before being discharged to the storm drain?		\boxtimes		
D16	Is the section of construction road between the wheel washing bay and the public road surfaced with crushed stone or coarse gravel?		\boxtimes		
D17	Is wastewater generated from concreting, plastering, internal decoration, cleaning work and other similar activities screened to remove large objects?		\boxtimes		
D18	Are the vehicle and plant serving areas, vehicle wash bays and lubrication facilities located under roofed areas?		\boxtimes		
D19	Is leakage or spillages contained and cleaned up immediately?		\boxtimes		
D20	Does the surface runoff from bunded areas pass through oil/grease traps prior to discharge to the storm water system?	\boxtimes			N.A.

D21	Are site drainage systems provided over the entire project site with sediment control facilities?		\boxtimes		
D22	Are sedimentation tanks or package treatment systems provided to treat the large amount of sediment-laden wastewater generated from wheel washing, site runoff and construction works?		\boxtimes		
D23	Is the generated wastewater with high concentrations of SS collected to the sedimentation tanks or package treatment systems for proper treatment prior to disposal?		\boxtimes		
D24	Is the treated wastewater reused for vehicle washing, dust suppression and general cleaning?		\boxtimes		
D25	Is the sewage generated from toilets collected using a temporary storage system?		\boxtimes		
D26	Is there any sediment plume observed in nearby watercourses?			\boxtimes	
D27	Are slit-grease traps deployed to prevent a direct input of road surface runoff to the marine waters?	\boxtimes			N.A.
E	Waste / Chemical Management	N/A or Not Observed	Yes	No	Remarks / Photo
Genera	al Waste				
E1	Is the general waste generated on-site stored in enclosed bins or compaction units separately from the construction and chemical wastes?		\boxtimes		
E2	Is the general waste collected properly by using the waste separation facilities for paper, aluminium cans, plastic bottles etc.?		\boxtimes		
E3	Does accumulation of waste avoid?		\boxtimes		
E4	Is waste disposed regularly?		\boxtimes		
Constr	ruction Waste				
E5	Are the temporary stockpiles maintained regularly?		\boxtimes		
E6	Is the excavated fill material reused for backfilling and reinstatement?		\boxtimes		
E7	Are the C&D materials sorted and recycled onsite?		\boxtimes		
E8	Is there any contract documents provided to allow and promote the use of recycled aggregates where appropriate?	\boxtimes			Not Observed
E9	Is the disposal of C&D materials avoided onto any sensitive locations e.g. agricultural lands etc.?	\boxtimes			N.A.
E10	Are the public fill and C&D waste segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal?				
E11	Is the durable formwork or plastic facing for construction works used?	\boxtimes			N.A.
E12	Do the wooden hoardings avoid to be used?		\boxtimes		
E13	Is metal hoarding used to enhance the possibility of recycling?	\boxtimes			

Contract No. SS H504 Design and Construction of

Chai Wan Government Complex and Vehicle Depot

Environmental Site Inspection Checklist (Rev. 1)

Report No. <u>0198-20250918</u>

E14	Is the segregation and storage of C&D wastes undertaken in designated area?		\boxtimes	
E15	Are waste storage area properly cleaned and do not cause windblown litter and dust nuisance?		\boxtimes	
E16	Do the excavated materials appear contaminated?		\boxtimes	
E17	If suspected contaminated, appropriate procedures followed?	\boxtimes		N.A.
Chemi	cal / Fuel Storage Area			
E18	Are the fuel tanks and chemical storage areas provided with locks and sited on sealed areas?		\boxtimes	
E19	Are the storage area enclosed 3 sides by walls/ fence of ≥2m tall and bounded with adequate bund capacity (>110% of largest container) or do the storage area allow storage of 20% of total volume of waste?			
E20	Are the storage areas labelled and separated (if needed)?		\boxtimes	
E21	Do the storage areas have adequate ventilation and be covered to prevent rainfall entering?		\boxtimes	
E22	Are the containers used for the storage of chemical wastes suitable for the substance that are holding, resist to corrosion, maintained in a good condition, and securely closed?		\boxtimes	
E23	If no specification has been approved by EPD, are container with <450L capacity provided for storage of chemicals waste?		\boxtimes	
Chemi	cal Waste / Waste Oil			
E24	Is chemical waste or waste oil stored and labelled in English and Chinese properly in designated area?		\boxtimes	
E25	Are chemicals and waste oil recycled or disposed properly?		\boxtimes	
E26	Is waste oil collected and stored for recycling or disposal?		\boxtimes	
Record	<u>ds</u>			
E27	Is a licensed waste haulier used for waste collection?		\boxtimes	
E28	Are the records of quantities of wastes generated, recycled, and disposed properly kept?		\boxtimes	
E29	For the demolition material/ waste, is the number of loads for each day recorded as appropriate?	\boxtimes		N.A.

F	Landscape and Visual Impacts	N/A or Not Observed	Yes	No	Remarks / Photo
F1	Is the work site confined within site boundaries?		\boxtimes		
F2	Is damage to surrounding areas avoided?		\boxtimes		
F3	Is the hoardings with aesthetic treatment provided and designed to be subtle and camouflaged?		\boxtimes		
F4	Is the temporary landscape treatment provided (such as the provision of temporary landscape planting around the Site office in ornamental pots and application of green roof for Site office)?		\boxtimes		
F5	Are the protective fencing erected along or beyond the perimeter of the tree protection zone of each individual tree?	\boxtimes			To be implemented before demolition of hoarding
G	Environmental Complaint	N/A or Not Observed	Yes	No	Remarks / Photo
G1	Number of Environmental Complaint received between inspection weeks.			\boxtimes	
Н	General Housekeeping	N/A or Not Observed	Yes	No	Remarks / Photo
H1	Are potential stagnant pools cleared and mosquito breeding prevented?		\boxtimes		
H2	Are the defined boundaries of working areas identified to prevent loss of vegetation		\boxtimes		
I	Others	N/A or Not Observed	Yes	No	Remarks / Photo
I1	Are the portable toilets maintained in a state, which will not deter the workers from utilizing these portable toilets?		\boxtimes		

Follow up action for previous Site Inspection:

10 September 2025 Observation

To be updated with Contractor's input.

Reminder(s):

 Opened cement bags were observed at the upper rooftop. (Photo O1)



Photo O1

Corrective Actions - Mitigation Measures Implemented or Proposed (if any):

1. The Contractor is reminded to cover the opened cement bags or any other dusty materials with impervious sheets after use

	Environmental Team Representative:	IEC's Representative:	Contractor's Representative:	CE/COW's Representative
Signature:	Notalie	1		N.
Name:	Natalie Wong	1	Desmond Ho	LICHTIY
Date:	18 September 2025	1	18 September 2025	18 September 2025

Inspection Date:	25 September 2025	Inspected By:	Natalie Wong
Time:	15:00 – 15:45	Weather Condition:	Cloudy
Participants:	Mr. L.K.Chiu (CE/COW's Represen	tative); Eric Leung (Con	tractor); Natalie Wong (ET)

					.
Α	Permits/Licenses	N/A or Not Observed	Yes	No	Remarks / Photo
A1	Are Environmental Permit, license/ other permit displayed at major site exit and vehicle access?		\boxtimes		EP No.: EP-505/2015/A
A2	Are Construction Noise Permits available for inspection/posted at site entrance.		\boxtimes		
A3	Is wastewater discharge licence available for inspection?		\boxtimes		
A4	Are trip tickets for chemical waste and construction waste disposal available for inspection?		\boxtimes		
A5	Are relevant licence/permit for disposal of construction waste or excavated materials available for inspection?		\boxtimes		
В	Air Quality	N/A or Not Observed	Yes	No	Remarks / Photo
B1	Is open burning avoided?		\boxtimes		
B2	Are completed earthworks sealed as soon as practicable?		\boxtimes		
В3	Are plant and equipment well maintained (i. e. without black smoke from powered plant)?		\boxtimes		
B4	Are NRMM labels properly affixed on the PMEs?		\boxtimes		
B5	Any remedial action undertaken?	\boxtimes			N.A.
В6	Observed dust source(s)				
		⊠ Wind eros	ion		
			quipment	Movemer	nts
		☐ Loading/ ι	unloading	of materia	als
		Others: _			
В7	Are unpaved areas/ designated roads watered regularly to avoid dust generation?		\boxtimes		
B8	Are dusty materials covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the excavation or unloading?				
B9	After removal of stockpile, are the remained dusty materials wetted with water and cleared from surface of roads?		\boxtimes		
B10	Is the stockpile of dusty materials avoid to be extend beyond the pedestrian barriers, fencing or traffic cones?		\boxtimes		
B11	Are loaded dump trucks covered by impervious sheeting appropriately before leaving the site?	\boxtimes			N.A.

B12	Are wheel washing facilities with high pressure water jet provided at all site exits if practicable?		\boxtimes	
B13	Are all vehicles and plant cleaned before they leave the construction site?		\boxtimes	
B14	Are hoarding ≥ 2.4m tall provided beside roads or		\boxtimes	
B15	area with public access? Is the portion of any road leading only to construction site (within 30m of a vehicle entrance		\boxtimes	
B16	or exit) kept clear of dusty materials?			
БІО	Are surfaces where any pneumatic or power-driven drilling, cutting, polishing or other mechanical			
	breaking operations takes place sprayed with water or a dust suppression chemical continuously?			
B17	Is the area involved demolition activities sprayed			
ווט	with water or a dust suppression chemical immediately prior to, during and immediately after the activities so as to maintain the entire surface wet?			N.A.
B18	Is scaffolding erected around the perimeter of a building under construction?		\boxtimes	
B19	Are effective dust screens, sheeting or netting provided to enclose the scaffolding from the ground floor level of the building, or a canopy provided from the first floor level up to the highest level of the scaffolding?		\boxtimes	
B20	Is the skip hoist for materials transport enclosed by impervious sheeting?	\boxtimes		N.A.
B21	Is every stock of more than 20 bags of cement or			
	dry pulverized fuel ash (PFA) covered entirely by impervious sheeting or placed in an area sheltered on the top and 3 sides?			Observation 1
B22	Are the areas of washing facilities and the road section between the washing facilities and the exit point paved with concrete, bituminous materials or hardcores?		\boxtimes	
B23	Are cement or dry PFA delivered in bulk stored in a closed silo fitted with an audible high-level alarm which is interlocked with the material filling line and no overfilling is allowed?		\boxtimes	
B24	Are the activities of loading, unloading, transfer, handing or storage of bulk cement or dry PFA carried out in a totally enclosed system or facility?		\boxtimes	
B25	Is any vent or exhaust fitted with an effective fabric filter or equipment air pollution control system?	\boxtimes		N.A.
B26	Is the exposed earth properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabiliser within six months after last construction activity on the		\boxtimes	
	construction site or part of the construction site where the exposed earth lies?			
B27	Are the worksites wetted with water regularly?		\boxtimes	
B28	Is generation of dust avoided during loading or unloading?		\boxtimes	
B29	Are all trucks loaded to a level within the side and tail boards?		\boxtimes	

Contract No. SS H504 Design and Construction of Chai Wan Government Complex and Vehicle Depot

Report No. <u>0199-20250925</u>

B31 Are designated roads paved?	B30	Are appropriate speed limit sign displayed?		\boxtimes				
C Noise	B31	Are designated roads paved?		\boxtimes				
Secondary Seco	B32			\boxtimes				
Secondary Seco								
Served regularly?	С			Yes	No	Remarks / Photo		
down while not in use?	C1	served regularly?		\boxtimes				
Are the silencers or mufflers properly fitted on construction equipment and maintained regularly? Are mobile and/or noisy plant sited as far away from NSRs as possible and practicable and orientated so that the noise is directed away from nearby NSRs? C6 Are material stockpiles, mobile container officer and other structures utilised to screen noisy activates? Is temporary hoarding installed located on the site boundaries between noisy construction activities and NSRs? Are noise barriers (typically density @14kg/m²) acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs? C9 Is the sequencing operation of construction plants where practicable? C10 Is the hoarding maintained properly? C11 Do air compressor shave valid noise labels? C12 Are compressor operated with doors closed? C13 QPME used with valid noise labels? C14 Major noise source(s)	C2			\boxtimes				
C4 construction equipment and maintained regularly? Are mobile and/or noisy plant sited as far away from NSRs as possible and practicable and orientated so that the noise is directed away from nearby NSRs? C6 Are material stockpiles, mobile container officer and other structures utilised to screen noisy activates? Is temporary hoarding installed located on the site boundaries between noisy construction activities and NSRs? Are noise barriers (typically density @14kg/m²) acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs? C9 Is the sequencing operation of construction plants where practicable? C10 Is the hoarding maintained property? C11 Do air compressors have valid noise labels? C12 Are compressor operated with doors closed? C13 QPME used with valid noise labels? C14 Major noise source(s) C15 Construction activities outside of site	C3	Is the noise directed away from nearby NSRs?		\boxtimes				
C5 NSRs as possible and practicable and orientated so that the noise is directed away from nearby NSRs? C6 Are material stockpiles, mobile container officer and other structures utilised to screen noisy activates? Is temporary hoarding installed located on the site boundaries between noisy construction activities and NSRs? C7 Are noise barriers (typically density @14kg/m²) acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs? C9 Is the sequencing operation of construction plants where practicable? C10 Is the hoarding maintained properly? C11 Do air compressors have valid noise labels? C12 Are compressor operated with doors closed? C13 QPME used with valid noise labels? C14 Major noise source(s) C15 Construction activities inside of site C16 Construction activities outside of site	C4	construction equipment and maintained regularly?		\boxtimes				
other structures utilised to screen noisy activates? Is temporary hoarding installed located on the site boundaries between noisy construction activities and NSRs? Are noise barriers (typically density @14kg/m²) acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs? Is the sequencing operation of construction plants where practicable? C10 Is the hoarding maintained properly? C11 Do air compressors have valid noise labels? C12 Are compressor operated with doors closed? C13 QPME used with valid noise labels? C14 Major noise source(s) N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A. N.A.	C5	NSRs as possible and practicable and orientated so that the noise is directed away from nearby NSRs?		\boxtimes				
C7 boundaries between noisy construction activities and NSRs? Are noise barriers (typically density @14kg/m²) acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs? C9 Is the sequencing operation of construction plants where practicable? C10 Is the hoarding maintained properly? C11 Do air compressors have valid noise labels? C12 Are compressor operated with doors closed? C13 QPME used with valid noise labels? C14 Major noise source(s) C15 Construction activities inside of site C16 Construction activities outside of site	C6		\boxtimes			N.A.		
acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc. provided to protect NSRs? C9 Is the sequencing operation of construction plants where practicable? C10 Is the hoarding maintained properly? C11 Do air compressors have valid noise labels? C12 Are compressor operated with doors closed? C13 QPME used with valid noise labels? C14 Major noise source(s) C15 Construction activities inside of site C16 Construction activities outside of site	C7	boundaries between noisy construction activities		\boxtimes				
where practicable? C10 Is the hoarding maintained properly? C11 Do air compressors have valid noise labels? C12 Are compressor operated with doors closed? C13 QPME used with valid noise labels? C14 Major noise source(s) C15 Construction activities inside of site C16 Construction activities outside of site	C8	acoustic mat or full enclosure close to noise plants including air compressor, generators and saw etc.		\boxtimes				
C11 Do air compressors have valid noise labels? C12 Are compressor operated with doors closed? C13 QPME used with valid noise labels? C14 Major noise source(s) Traffic Construction activities inside of site	C9			\boxtimes				
C12 Are compressor operated with doors closed? C13 QPME used with valid noise labels? C14 Major noise source(s) Traffic Construction activities inside of site Construction activities outside of site	C10	Is the hoarding maintained properly?		\boxtimes				
C13 QPME used with valid noise labels? C14 Major noise source(s) Traffic Construction activities inside of site Construction activities outside of site	C11	Do air compressors have valid noise labels?		\boxtimes				
C14 Major noise source(s) Traffic Construction activities inside of site Construction activities outside of site				\boxtimes				
☐ Traffic ☐ Construction activities inside of site ☐ Construction activities outside of site	C13	QPME used with valid noise labels?		\boxtimes				
Construction activities inside of site Construction activities outside of site	C14	Major noise source(s)						
Construction activities outside of site			Traffic					
			Construction activities inside of site					
Others:			Construction activities outside of site					
·			Others:					

D	Water Quality	N/A or Not Observed	Yes	No	Remarks / Photo
Constr	ruction Activities				
D1	Are catchpits and perimeter channels constructed in advance of site formation works and earthworks?		\boxtimes		
D2	Is wastewater from temporary site facilities controlled to prevent direct discharge to surface or marine water?		\boxtimes		
D3	Is minimise surface excavation works during rainy seasons (April to September), as possible?		\boxtimes		
D4	Is the storm drainage directed to storm drains via adequately designed sand/ silt removal facilities e.g. sand traps, silt?		\boxtimes		
D5	Are channels, earth bunds or sandbag barriers provided on site to properly direct stormwater to such silt removal facilities?		\boxtimes		
D6	Are the silt removal facilities, channels and manholes maintained regularly?		\boxtimes		
D7	Are the temporary access roads surfaced with crushed stone or gravel?		\boxtimes		
D8	Is the deposited silt and grit removed regularly?		\boxtimes		
D9	Is rainwater pumped out from trenches discharged into storm drains via silt system?		\boxtimes		
D10	Are measures taken to prevent the washout of construction materials, soil, silt or debris into any drainage system?		\boxtimes		
D11	Are open stockpiles of construction materials e.g. aggregates and sand on site covered with tarpaulin or similar fabric during rainstorms?		\boxtimes		
D12	Are manholes adequately covered and temporarily sealed so as to prevent silt, construction materials or debris from getting into the drainage?		\boxtimes		
D13	Are the discharges of surface run-off into foul sewer always prevented?		\boxtimes		
D14	Is a wheel washing bay provided at every site exit?		\boxtimes		
D15	Is the wheel wash overflow directed to silt removal facilities before being discharged to the storm drain?		\boxtimes		
D16	Is the section of construction road between the wheel washing bay and the public road surfaced with crushed stone or coarse gravel?		\boxtimes		
D17	Is wastewater generated from concreting, plastering, internal decoration, cleaning work and other similar activities screened to remove large objects?		\boxtimes		
D18	Are the vehicle and plant serving areas, vehicle wash bays and lubrication facilities located under roofed areas?		\boxtimes		
D19	Is leakage or spillages contained and cleaned up immediately?		\boxtimes		
D20	Does the surface runoff from bunded areas pass through oil/grease traps prior to discharge to the storm water system?	\boxtimes			N.A.

D21	Are site drainage systems provided over the entire project site with sediment control facilities?		\boxtimes		
D22	Are sedimentation tanks or package treatment systems provided to treat the large amount of sediment-laden wastewater generated from wheel washing, site runoff and construction works?		\boxtimes		
D23	Is the generated wastewater with high concentrations of SS collected to the sedimentation tanks or package treatment systems for proper treatment prior to disposal?		\boxtimes		
D24	Is the treated wastewater reused for vehicle washing, dust suppression and general cleaning?		\boxtimes		
D25	Is the sewage generated from toilets collected using a temporary storage system?		\boxtimes		
D26	Is there any sediment plume observed in nearby watercourses?			\boxtimes	
D27	Are slit-grease traps deployed to prevent a direct input of road surface runoff to the marine waters?	\boxtimes			N.A.
E	Waste / Chemical Management	N/A or Not Observed	Yes	No	Remarks / Photo
Genera	al Waste				
E1	Is the general waste generated on-site stored in enclosed bins or compaction units separately from the construction and chemical wastes?		\boxtimes		
E2	Is the general waste collected properly by using the waste separation facilities for paper, aluminium cans, plastic bottles etc.?		\boxtimes		
E3	Does accumulation of waste avoid?		\boxtimes		
E4	Is waste disposed regularly?			\boxtimes	Observation 2
Const	ruction Waste				
E5	Are the temporary stockpiles maintained regularly?		\boxtimes		
E6	Is the excavated fill material reused for backfilling and reinstatement?		\boxtimes		
E7	Are the C&D materials sorted and recycled onsite?		\boxtimes		
E8	Is there any contract documents provided to allow and promote the use of recycled aggregates where appropriate?	\boxtimes			Not Observed
E9	Is the disposal of C&D materials avoided onto any sensitive locations e.g. agricultural lands etc.?	\boxtimes			N.A.
E10	Are the public fill and C&D waste segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal?		\boxtimes		
E11	Is the durable formwork or plastic facing for construction works used?	\boxtimes			N.A.
E12	Do the wooden hoardings avoid to be used?		\boxtimes		
E13	Is metal hoarding used to enhance the possibility	\boxtimes			

of recycling?

Contract No. SS H504 Design and Construction of

Report No. _0199-20250925

Chai Wan Government Complex and Vehicle Depot Environmental Site Inspection Checklist (Rev. 1)

E14	Is the segregation and storage of C&D wastes		\boxtimes		
	undertaken in designated area?				
E15	Are waste storage area properly cleaned and do		\boxtimes		
	not cause windblown litter and dust nuisance?				
E16	Do the excavated materials appear contaminated?		\boxtimes		
E17	If suspected contaminated, appropriate procedures	\boxtimes			N.A.
	followed?	<u> </u>			1437 G
	cal / Fuel Storage Area				
E18	Are the fuel tanks and chemical storage areas		\boxtimes		
	provided with locks and sited on sealed areas?				
E19	Are the storage area enclosed 3 sides by walls/		\boxtimes		
	fence of ≥2m tall and bounded with adequate bund	_			
	capacity (>110% of largest container) or do the				
	storage area allow storage of 20% of total volume				
=	of waste?				
E20	Are the storage areas labelled and separated (if		\boxtimes		
E04	needed)?				
E21	Do the storage areas have adequate ventilation		\boxtimes		
F00	and be covered to prevent rainfall entering?				
E22	Are the containers used for the storage of chemical		\boxtimes		
	wastes suitable for the substance that are holding,				
	resist to corrosion, maintained in a good condition, and securely closed?				
E23	If no specification has been approved by EPD, are				
LZJ	container with <450L capacity provided for storage		\boxtimes		
	of chemicals waste?				
	of chemicals waste:				
<u>Chemi</u>	cal Waste / Waste Oil				
E24	Is chemical waste or waste oil stored and labelled		\boxtimes		
	in English and Chinese properly in designated				
	area?				
E25	Are chemicals and waste oil recycled or disposed		\boxtimes		
	properly?			Ш	
E26	Is waste oil collected and stored for recycling or		\boxtimes		
	disposal?				
Record	<u>as</u>				
E27	Is a licensed waste haulier used for waste		\boxtimes		
	collection?				
E28	Are the records of quantities of wastes generated,		\boxtimes		
	recycled, and disposed properly kept?				
E29	For the demolition material/ waste, is the number	\boxtimes			N.A.
	of loads for each day recorded as appropriate?				IN.A.

F	Landscape and Visual Impacts	N/A or Not Observed	Yes	No	Remarks / Photo
F1	Is the work site confined within site boundaries?		\boxtimes		
F2	Is damage to surrounding areas avoided?		\boxtimes		
F3	Is the hoardings with aesthetic treatment provided and designed to be subtle and camouflaged?		\boxtimes		
F4	Is the temporary landscape treatment provided (such as the provision of temporary landscape planting around the Site office in ornamental pots and application of green roof for Site office)?		\boxtimes		
F5	Are the protective fencing erected along or beyond the perimeter of the tree protection zone of each individual tree?	\boxtimes			To be implemented before demolition of hoarding
G	Environmental Complaint	N/A or Not Observed	Yes	No	Remarks / Photo
G1	Number of Environmental Complaint received between inspection weeks.			\boxtimes	
Н	General Housekeeping	N/A or Not Observed	Yes	No	Remarks / Photo
H1	Are potential stagnant pools cleared and mosquito breeding prevented?		\boxtimes		
H2	Are the defined boundaries of working areas identified to prevent loss of vegetation		\boxtimes		
I	Others	N/A or Not Observed	Yes	No	Remarks / Photo
I1	Are the portable toilets maintained in a state, which will not deter the workers from utilizing these portable toilets?		\boxtimes		

Follow up action for previous Site Inspection:

10 September 2025 Observation

1. General waste near the drainage system was removed. (Photo R1)



R1

18 September 2025 Observation

1. The cement bags were properly removed after works. (Photo R2)



R2

Observation(s):

- 1. A stock of more than 20 bags of cement was observed without covering by impervious sheets on LG. (Photo 1)
- 2. Waste was observed accumulated and had exceeded the capacity of the original sorting facilities on L1. (Photo 2)





Photo O1

Photo O2

Corrective Actions – Mitigation Measures Implemented or Proposed (if any):

- 1. The Contractor was recommended to cover the stock of cement with impervious sheets.
- 2. The Contractor was recommended to increase the frequency of waste disposal to avoid waste accumulation.

	Environmental Team Representative:	IEC's Representative:	Contractor's Representative:	CE/COW's Representative
Signature:	Notalie	1	7	N.
Name:	Natalie Wong	1	Desmond Ho	LKCHM
Date:	25 September 2025	1	25 September 2025	25 September 2025

Appendix 10

2025	Octo	ber				
MONDAY	TUESDAY	WEDNESDAY	THURSDAY	FRIDAY	SATURDAY	SUNDAY
29	30	01	02	03	04	05
06	07	08	09 Noise Monitoring (NM1, NM2b and NM3)	10	11	12
13	14 Noise Monitoring (NM1, NM2b and NM3)	15	16	17	18	19
20	21 Noise Monitoring (NM1, NM2b and NM3)	22	23	24	25	26
27 Noise Monitoring (NM1, NM2b and NM3)	28	29	30	31	01	02
03	04	Notes: The schedule is seetc.).	ubject to change due	to unforeseeable	e circumstances (e.g. a	adverse weather,

Appendix 11

There was no Notification of Environmental Quality Limits Exceedance in the reporting month.

Appendix 12

Environmental Complaints Log

Complaint Ref. No.	Date of Complaint Received	Received from	Received by	Aspect of Complaint	Date of Investigation	Investigation Summary & Conclusion	Date of Reply
C001_20240912	12 Sep 2024	EPD	ET	Noise	12, 19 & 26 September 2024, and 4, 10, 17 & 24 October 2024	During the EPD liaison meeting on 12 September 2024, ER, IEC, ET and Contractor were noted that EPD received a complaint regarding construction noise on Sundays from the construction site of the Chai Wan Government Complex and Vehicle Depot in September 2024. Subsequently, this information was communicated from EPD to ET via email on 9 October 2024. In summary of the investigation, no significant noise nuisance was generated from the site activities conducted on 1 and 8 September 2024 (Sunday). Additionally, noise mitigation measures were implemented prior to September. In conclusion, there is no direct evidence showing that the complaint is related to the construction site of the Chai Wan Government Complex and Vehicle Depot.	5 Nov 2024

Remarks:

- "ER" equal to "Engineer's Representative"
 "IEC" equal to "Independent Environmental Checker"
 "ET" equal to "Environmental Team"
 "EPD" equal to "Environmental Protection Department"

Environmental Enquiries Log

Enquiry Ref. No.	Date of Enquiry Received	Received from	Received by	Aspect of Complaint	Date of Investigation	Investigation Summary & Conclusion	Date of Reply
NA	NA	NA	NA	NA	NA	NA	NA

Remarks:

- "ET" equal to "Environmental Team"
 "EPD" equal to "Environmental Protection Department"
 "NA" equal to "Not Applicable"

Cumulative Statistics on Complaints

Aspects	Cumulative No. Brought Forward	No. of Complaints during reporting period	Cumulative Project-to- Date
Air Quality	0	0	0
Noise	1*	0	1*
Water Quality	0	0	0
Waste Management	0	0	0
Total	1*	0	1*

Remarks:

1. *Equal to non-project related after the investigation.

Prepared by:

Aurecon Hong Kong Limited
Unit 1608, 16/F, Tower B, Manulife Financial Centre,
223 – 231 Wai Yip Street, Kwun Tong,
Kowloon Hong Kong S. A. R.

T: +852 3664 6888



Bringing ideas

F: +852 3664 6999

E: hongkong@aurecongroup.com